


HARRISON COUNTY CORNER REFERENCE

TOWNSHIP 5 SOUTH RANGE 4 EAST

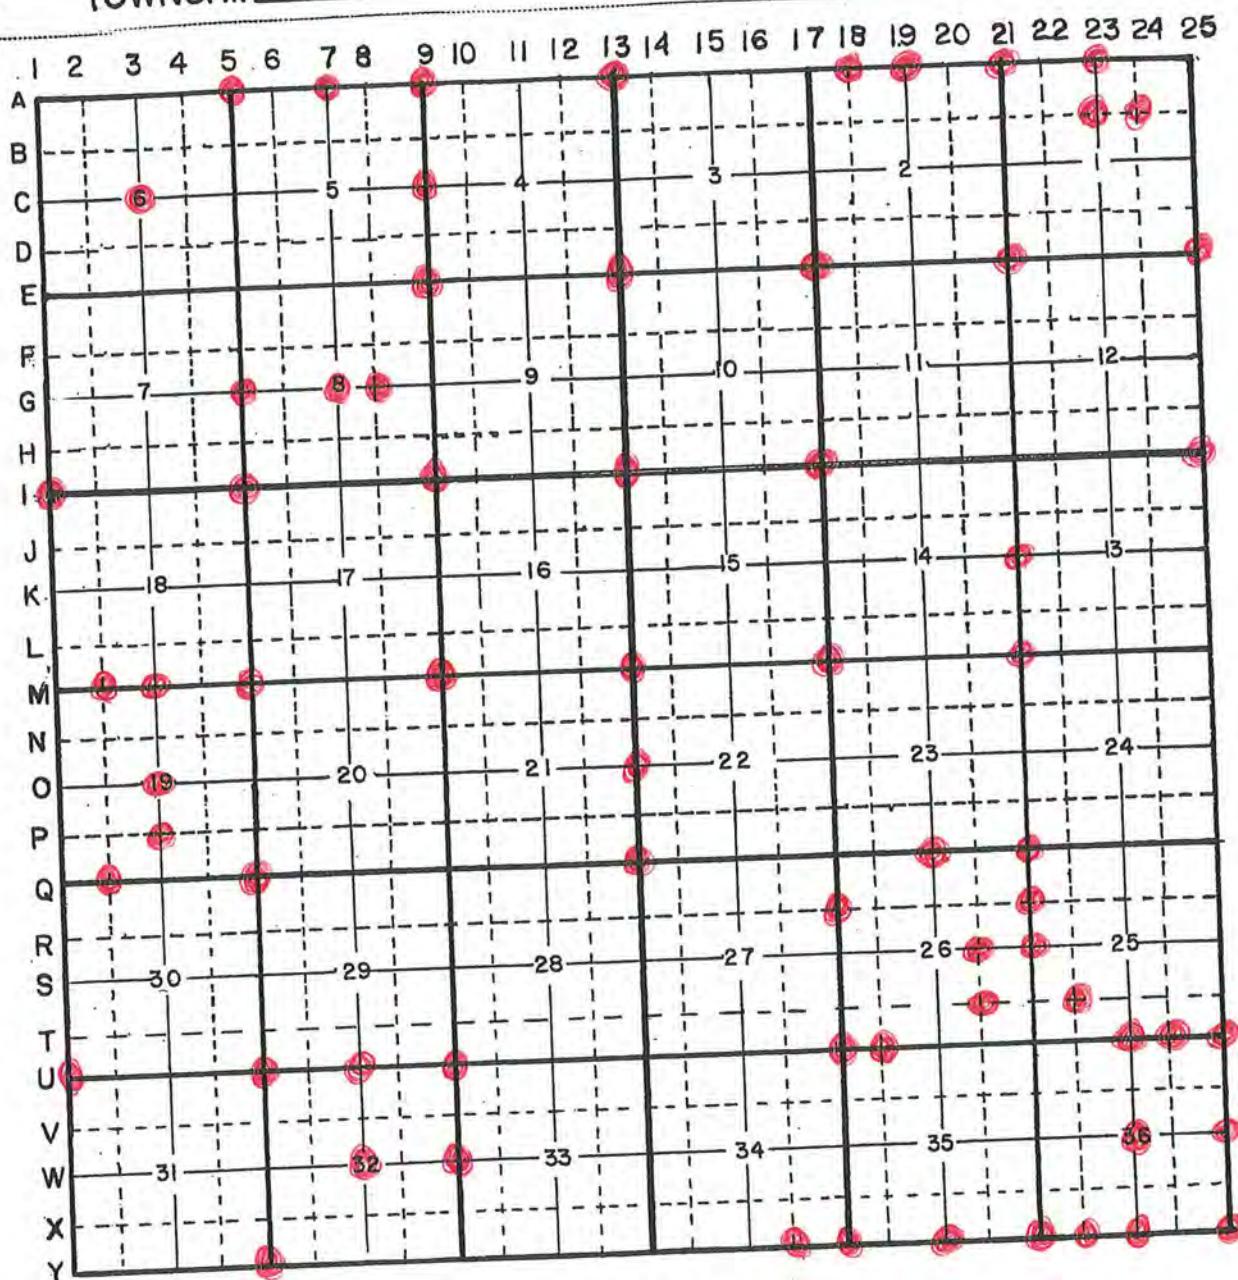

1-I

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County Surveyor's Reference Index Number: **I-1** & I-25

T 5 S R 4 E & R 5 E 2nd Mer., County Harrison State Indiana


East Section Corner common to Sections 12 & 13, T-5-S, R-4-R

and

West Section Corner common to Sections 7 & 18, T-5-S, R-5-E

EXISTING SURVEYS

No Original Government Survey Evidence Recovered	Picture/Sketch
See survey recorded in Instrument Number 200206583.	
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc...)	Year of search <u>2015</u> By <u>VHM</u> Recovered railroad spike, 0.3' deep.
Bearing Trees, Reference Objects	Perpetuation Record
Species _____ Diameter _____ Bearing _____ Distance _____	Monument and accessories established. Include brief description of area. Set mag nail in concrete plug over railroad spike in centerline-centerline of Indiana State Highway 11 and Harrison County Park Corner accessories established: Pine, 14", N 5° W, 32.07', MN +1.0' on West side. Utility Pole, S 54° E, 71.28', with Harrison County Surveyor's sign, bottom nail. R.O.W. Monument, S 45° W, 70.79'. N: 1032570.5 E: 228344.4
Signature <u>Vincent H. M.</u>	
Date: <u>11/02/15</u>	

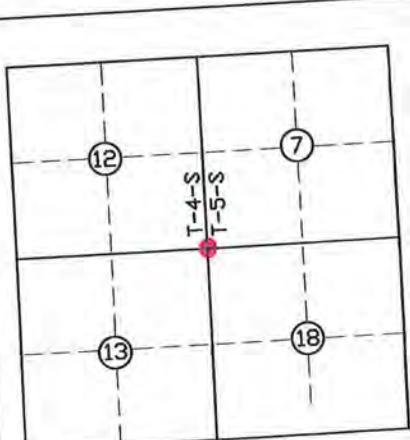

1-U

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County Surveyor's Reference Index Number: U-1

T 5 S R 4 E 2nd Mer., County Harrison State IndianaWest Section Corner common to Sections 30 and 31

EXISTING SURVEYS

No Original Government Survey Evidence Recovered	Picture/Sketch
See surveys recorded in Survey Book 4, Page 495 and Instrument Number 200700664.	
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc.)	Year of search <u>2015</u> By <u>VHM</u> Recovered pinnacle limestone, no visible marking, leaning South. Stone is $65^{\circ} \pm$ North of North edge of Otterbein Road.
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	
	Perpetuation Record Monument and accessories established. Include brief description of area. <u>Monument left as recovered. Set yellow rectangular Harrison County Surveyor's sign 1.5' North-Northeast of monument and placed a cairn of rocks around the monument. Corner accessories established: C. Oak 9", N 23° W, 5.7', MN + 0.6' on East side.</u> <u>W. Oak, 20", N 66 ° E, 8.7', MN + 1.0' on South side.</u> <u>Beech 5" w/3 hacks, S 4° W, 14.0'.</u> <u>Remnants of old woven wire fence just South of monument.</u> N: 1017477.3 E: 193897.6
Signature <u>Vin H. M</u>	
Date: <u>11/02/15</u>	

CORNER RECORD

PAGE

HARRISON COUNTY

2-M

CORNER 2-M

TOWNSHIP 5 SOUTH

RANGE 4 EAST 2 ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
N.W. Cor. N.E. $\frac{1}{4}$ N.W. $\frac{1}{4}$ Sec. 19	Stone	30" Beech	27.65	N16-10-20W	3-22-82	T.B.	#1Pg. 74	Sign Placed
		9" Cedar	41.05	S58-35-30	3-22-82	T.B.		Sign Placed
			70.00	N68-00-10W	3-22-82	T.B.		Sign Placed

2-M

↑ N

Date 3-22-82

double oak 1.80'0
south fork nail
1.65'0 on south
side

W.W. Cor NE 1/4 NW 1/4

Sec't 19, T 5 S

R 4 E

2-M

2.5'0
1.65'0
1.00'0
0'0

3.0'0
2.5'0 beach nail 2.4' up nail on south
side

N 16° 10' 20" W
27.615

Stone is mounted with four + signs
Stone 1.80x.80x3.8 up.

All trees have double signs
+ bags with a album nail in
middle

2.5'0 3.5'0
4.0'0

.80'0 cedar nail 2.2' up
.7' nail on south side

Party Chief T. Brown

Head Chain M. Donald

Rock Chain B. Cain

Page 11

HARRISON

COUNTY

*2-Q.*CORNER 2-QTOWNSHIP 5RANGE 4 EAST

2ND PRINCIPAL MERIDIAN

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
SW CORNER, SE $\frac{1}{4}$, SW $\frac{1}{4}$, Section 19	Stone marked with #4 Rebar 60. ϕ Beech	11.08	N54-51-10E 80. ϕ Cedar	3-5-90	T.B.	#4 PG.5		Sign Placed
			South 22.25	3-5-90	T.B.			Sign Placed
			S57-22-20W 40. ϕ Maple	11.85	3-5-90	T.B.		Sign Placed

Q-Q

W diagonal

STONE IS LAYING DOWN.
BUT IS MARKED WITH A
HORN RIBBON. THE STONE WAS
FOUND FROM A PREVIOUS
SURVEY. THE STONE IS
MAPLED WITH A NAIL.
POST & STONE.

557-22-224-11.85
0.40 Ø Maple, nail ⊖
IS ON EAST SIDE ↑
LID UP,

PARTY Chief T. Brown
Head Chain R. Chase
Rean Chain W. Schubach

ALL Trees have a date written
in, REAR. The stone is in middle of House 2.
witness sign
0.60 Ø Beech nail
ON NORTH SIDE ↑
N54-51-10E 11.03

STONE & #4 REAR
SOUTH 22.25

SW CAR, 2nd, 2nd, 2nd 19
T 25, R 4 E

0.80 Ø Cedar, nail is on
EAST SIDE ↑ 1.25 up.

3-5-70

3-C

DIEZGEN NO. 385-3		3-C	Page 32 3-C
SUR COR, 1/16 '44	SECT 6 T 55 R 4 E	STONE IS 0.60' X 0.30 X 0.35 OUT OF GROUND. STONE IS MARKED WITH A METAL POST & SIGN	
DATE 5-22-92	0.60' D maple, nail on		
EAST Side + 1.15 up	0.60' D maple, nail on Sun side		
1.15 up	1.10' up		
$1.36 - .43 = 10.95$	$1.31 - .38 = 1.92$		
0.60' D maple, nail on South side +	0.54	STONE All trees have a blaze with a aluminum in middle. All trees have a white faces sign	
1.10 up			
$5.82 - 1.17 = 4.65$			
P.C. T-Brown			
H.C. V. Gehlback			
P.C. A. Clements			

CORNER RECORD

PAGE _____

HARRISON COUNTY

3-M

CORNER 3-M

TOWNSHIP 5 SOUTH

RANGE 4 EAST 2 ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
N.W. Cor. N.E. $\frac{1}{4}$ Sec. 19	Stone	7" Hickory 15" ash 14" Oak	18.93	S0-37-20W	3-22-82	T.B.	#Pg. 75	Sign Placed Sign Placed Sign Placed
			27.90	S29-08-30W	3-22-82	T.B.		
			30.05	S84-05-30W	3-22-82	T.B.		

3-M

3 M

all trees have a witness sign + a blog with a allow nail gun middle.

Date 3-22-82

NW on NE 74.

Sept 19, 755 P.M.

3-m

14
1.10' & 0.6' nail 13 m.s.
nail on south side

Party Chair T. Brown
Head Chain M. Arnold
Rear Chain B. Cain

Stone is marked with post & signs

30.05
604-05.30W 5' Stone 30' x 60' x 90' up.

← 50-39-20w
1893

④ 60' Hickory, nail 13' up, nail on west side

PAGE
15

3-0

HARRISON

TX

CORNER 0-3

TOWNSHIP 5 S


RANGE 4 E EAST 2ND PRINCIPAL MERIDIAN

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	FROM CORNER?	DISTANCE	BEARING FROM CORNER	DATE CHECKED	FIELD BOOK	REMARKS
Center $\frac{1}{4}$ Corner Section 19	B. Oak	Limestone		21.7'	S 27 W	2006	TOB GDB	5/50
		9" Hickory		8.9'	N 60 W			

Wetzel - Vories
Sec. 19, T - S - 5 - E

Camp

Sec. corners T - Sec. 19, 20, 29 & 32
Recovered L-stone should be removed
0.3' deep

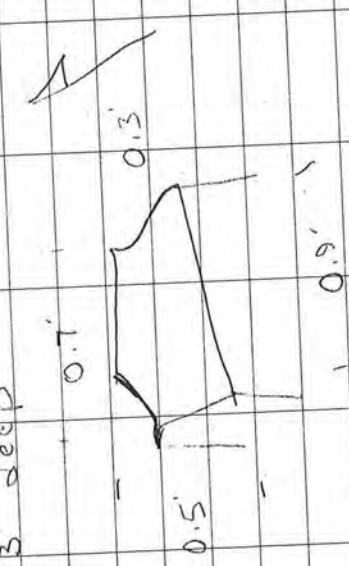


Camp


VHM
MKF

4/26/06
Camp

Sec. corners T - Sec. 19, 20, 29 & 32
Recovered L-stone should be removed
0.3' deep

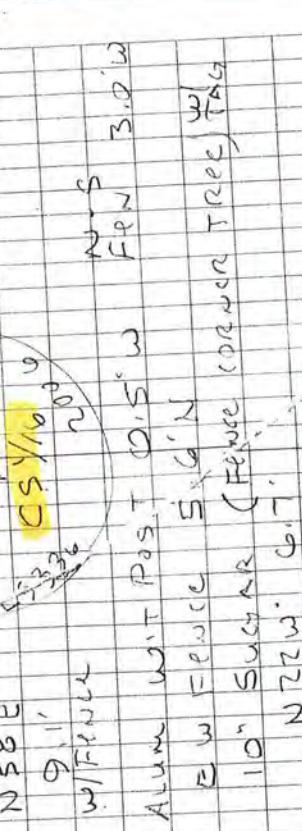

78: Hickory fence corner
is north 4.5 to center of
tree w/ tail
old down fence corner post
is south 2.0' fence to new
stone is 50' + E ast of
bottom of sink hole
placed in chair c. witness post
on w. side of stone

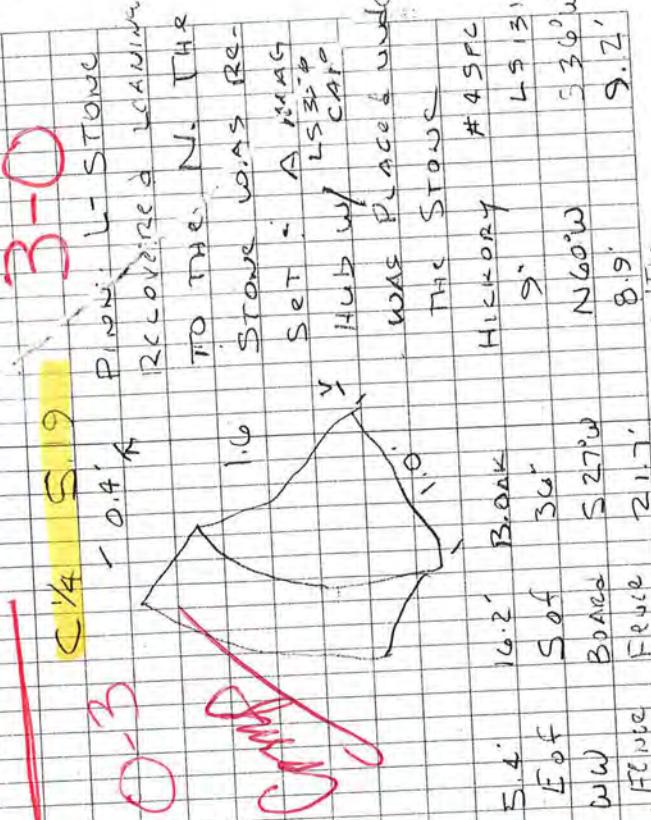

5/50

1/27
cost
50.00

Set #6 by 30"

w/ 3/4" alum

cap.

edge

36" tree stuf

9"

5.9

rate

Set #6

w/ cap.

edge

36" tree stuf

9"

5.9

rate

Set #6

w/ cap.

edge

36" tree stuf

9"

5.9

rate

Set #6

9"

5.9

</div

3-0

5/Pg. 50

HARRISON COUNTY SURVEYOR
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWN SHP: 55 RANGE: 4E SECTION: _____CORNER REF. I.D. D-3
DATE: 4/26/06MONUMENT INFORMATIONLOCATION: C 1/4 CORNER SEC 14DESCRIPTION: LIMESTONE

() ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: () YES DATE: / /

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. B. OAK 36"	()	()	21.7' S 27° E
2. 4" NICKORY	()	()	8.9' N 60° W
3.	()	()	

RECOVERED BY: JM

A	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24
B																								
C																								
D																								
E																								
F																								
G																								
H																								
I																								
J																								
K																								
L																								
M																								
N																								
O																								
P																								
Q																								
R																								
S																								
T																								
U																								
V																								
W																								
X																								
Y																								
Z																								

DATE: 4/26/06
DATE: / /
DATE: / /DATE: / / 06
DATE: / /
DATE: / /RECORDED IN PERPETUAL RECORDS BOOK:
BY: Thomas O. BuleDATE: 11/1/2006

HARRISON

TY

3-P

P-3

TOWNSHIP 5 S

PRINCIPAL MERIDIAN

CORNER

RANGE 4 E

EAST

2ND

PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNERS	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
CS 1/16 Section 19	#6 Rebar cap & post	9" Sugar	9.1'	N 58 E	2006.	TOB GDB	5/51	
			10" Sugar Fence Corn.	6.7'	N 22 W			

3-P

HARRISON COUNTY SURVEYOR ^{5/26/06}
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP. 5S RANGE: 4E SECTION: 19

CORNER REF. LD.: P-3
DATE: 4/26/06

MONUMENT INFORMATION

LOCATION: C 5 1/2 SEC 19



DESCRIPTION: #6 Rebar w/Cap + Post, S/W

ADDITIONAL DISTINGUISHING CHARACTERISTICS:

SIGN PLACED: () YES DATE: / /

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. 9" Sug+R	()	()	9.1 N 58° E
2. 10" Sug+R	()	()	6.9 N 22° W
3.	()	()	

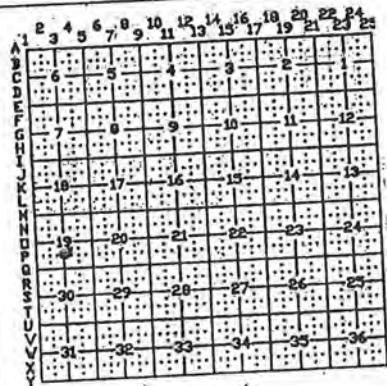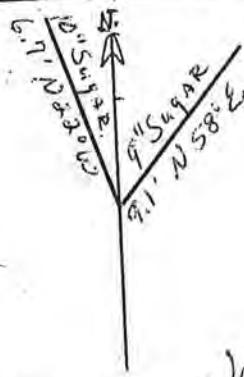

RECOVERED BY: VM

DATE: 4/ / 06
DATE: / /
DATE: / /

REFERENCED BY: TOB

DATE: 11/ / 06
DATE: / /
DATE: / /

RECORDED IN PERPETUAL RECORDS BOOK:
BY: Thomas O. Bule

DATE: 11/ / 2006

5-A



LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison Co. No. A-5

T 5 S R 4 E 2nd Principal Meridian County Harrison State Indiana

North Corner to Sections 5 and 6

EXISTING SURVEYS

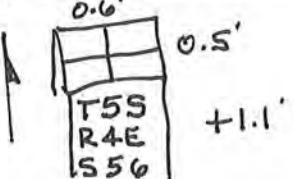
Original Government Survey	Original Evidence Found																
Year surveyed 1805 Original monument Wood Post (wood post, stone, pile of stones, etc.)	Year of search N/A By _____ Monument found _____																
Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____	Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____																
Subsequent Corner Restoration Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc...)	Evidence of Subsequent Corner Restoration Found Year of search 2002-2004 By VHM Recovered 0.5' by 0.6' limestone, projecting 1.1', with “+” cut on top and “T5S R4E S 5 6” on face.																
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____																	
At time of search: 1. Did you have the record description? Yes <input checked="" type="checkbox"/> No _____ 2. How was search area located? pacing, chaining, photo, maps, etc. SURVEYING 3. Man hours spent in search N/A 4. Do you think additional search might recover evidence? Yes _____ No <input checked="" type="checkbox"/> 5. Signature 	<p>Relation of Evidence to Record Features Along Section Lines Section line to sections _____ Object _____ Record Distance _____ Measured Distance _____</p> <p>Other Evidence Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any. Stone is situated at fence “T”, 42 feet West of centerline of Buck Creek Valley Road.</p> <p>Perpetuation Record Monument and accessories established. Include brief description of area. Stone left as recovered..</p> <table border="1"> <thead> <tr> <th>Fence</th> <th>W. Oak</th> <th>W. Oak</th> <th>Sugar</th> </tr> </thead> <tbody> <tr> <td>Post</td> <td>30"</td> <td>36"</td> <td>28"</td> </tr> <tr> <td>S 48° W</td> <td>S 53° E</td> <td>S 5° E</td> <td>N 57° E</td> </tr> <tr> <td>1.7'</td> <td>20.8'</td> <td>26.3'</td> <td>31.2'</td> </tr> </tbody> </table> <p>Certified corner restoration certificate prepared Yes _____ No <input checked="" type="checkbox"/> Filed in County records at Legal Survey Book 3, Page 27</p> <p>N: 1043702.7 ISPCS, East Zone, 1983 Datum (2002) E: 201658.3 US Survey Foot</p>	Fence	W. Oak	W. Oak	Sugar	Post	30"	36"	28"	S 48° W	S 53° E	S 5° E	N 57° E	1.7'	20.8'	26.3'	31.2'
Fence	W. Oak	W. Oak	Sugar														
Post	30"	36"	28"														
S 48° W	S 53° E	S 5° E	N 57° E														
1.7'	20.8'	26.3'	31.2'														

5-A

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County Surveyor's Reference Index Number: A-5

T 5 S R 4 E 2nd Mer. County Harrison State IndianaNorth Section Corner common to Sections 5 and 6

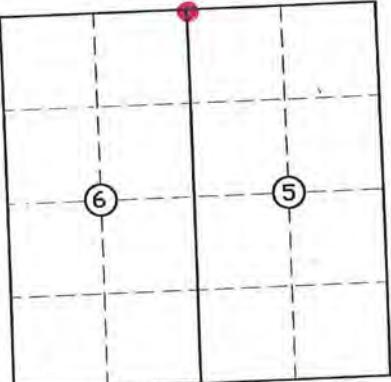EXISTING SURVEYS	
No Original Government Survey Evidence Recovered See surveys recorded in Legal Survey Book 3, Page 27 and Instrument Numbers 200400789 and 201402250.	Picture/Sketch 
Subsequent Corner Restoration Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc...)	Evidence of Subsequent Corner Restoration Found Year of search <u>2015</u> By <u>VHM</u> Recovered sandstone 0.5' x 0.6', in good condition, solid in ground, projecting 1.1' with "T5S R4E S 5•6" on South face, located at fence "T", 30' West of West edge of pavement, with carbonite post on West face.
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	
 Signature <u>V.H.M.</u> Date: <u>11/02/15</u>	Perpetuation Record Monument and accessories established. Include brief description of area. <u>Monument left as recovered. Corner accessories established: Oak, 39" S 5° E, 26.65' slope, MN + 0.5' in East crown root. Sugar, 11", S 12° W, 8.87', MN + 0.6' on East side with Harrison County Surveyor's sign. Sugar, 32", N 60° E, 30.77', MN + 0.6' in South crown root with Harrison County Surveyor's sign facing East. Fence Post, North-South wire, West 0.8'.</u> N: 1043703.1 E: 201658.7

5-G

CORNER G-5

HARRISON CC TY

TOWNSHIP 5 S

RANGE 4 E

EAST

2ND

PRINCIPAL MERIDIAN

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
SW Corner NW $\frac{1}{4}$ Sec. 8	Stone	14" Pignut w/ Harr. Co. sign	7.3'	N66E	3-25-03	MKF MAK	BK 4 pg 81	Carsonite Post Placed @ S edge of Stone Faint + cut on top

5-G

25 MAR 03

MKF
MARK

W 1/4 CORNER

LIMESTONE IN HEAVY WOODS
100' N OF PROMINENT SINKHOLE

N.
3'
1.1'

PIGNUT SUGAR

14" 8"

N66E S 18W (198)

7.3'
W/HAR.CO.
SIGN

WHITE OAK

16"

C7-5 =
SW CORN.
NW 1/4

S 88W (268)

20.1

CARBONITE POST PLACED AT S. EDGE OF STONE

PAINT + CUT ON TOP

RECORD

10

COUNTY

HARRISON

TOWNSHIP 5 SOUTH

CORNER — 5-1 —

CHURCHES 4 EAST 2 ND PRINCIPAL MERIDIAN

5-I

stone is .40 x .60, sticking .80 out of ground

5 RB on south side of stone

roofing nails in middle of base

3-12-81

South

East

West

S.W. corner Section 8

TSS, R4E

78-27-0

37-34-0

11.6

5.10

.40 maple

45 deg

11.39 SSW

5.10

118-05-0

8

11.6

5.10

.40 maple

5-M


**LAND CORNER RECORD
(RECTANGULAR SURVEY)**

Harrison County Surveyor's Reference Index Number: M-5

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 17, 18, 19 and 20

EXISTING SURVEYS

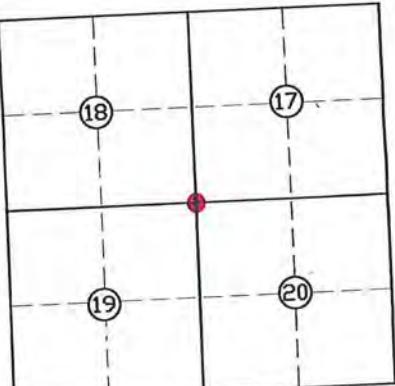EXISTING SURVEYS	
No Original Government Survey Evidence Recovered See surveys recorded in Survey Book 3, Page 450 and Survey Book 4, Page 207.	Picture/Sketch 
Subsequent Corner Restoration Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc...) _____	Evidence of Subsequent Corner Restoration Found Year of search <u>2015</u> By <u>VHM</u> Restored corner position per prior surveys.
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	
	<p style="text-align: center;">Perpetuation Record</p> <p>Monument and accessories established. Include brief description of area. Set #5 by 30" steel pin, with 3/4" aluminum disc stamped to depict the corner position. 0.6' deep, 1'± South of South edge of pavement of Old Goshen Road.. Corner accessories established: Water Meter, N 26° E, 69.12'. Drill hole (South end), S 72½° W, 52.36'. Wood fence corner, N 48½° W, 34.87'. Steel post with Harrison County Surveyor's sign, S 74° E, 72.45'.</p> <p>N: 1027618.4 E: 202015.5</p>
Signature <u>Victor H. M</u>	
Date: <u>11/02/15</u>	

5-Q

HARRISON

TX

CORNER Q-5 TOWNSHIP 5 S RANGE 4 E

PRINCIPAL MERIDIAN

19-20-30-29

LOCATION	DESCRIPTION OF		DISTANCE	BEARING	FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE							
Section Corner 19-20-30-29	28" Limestone	Hickory	4.5"	North	2006.	TOB GDB	5/52		
	Downed Fence Post		2.0'	South					

5-Q

5/pg 52


HARRISON COUNTY SURVEYOR
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWN SHP: 5 S RANGE: 4 E SECTION: _____CORNER REF. ID: Q-5
DATE: 4/26/06MONUMENT INFORMATIONLOCATION: Common Corner 19-20-30-29DESCRIPTION: Limestone w/Post

ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: YES DATE: 4/1/06WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. 2 8" Hickory	()	()	4.5' NORTH
2. DOWNED FENCE	()	()	2.0' SOUTH
3.	()	()	

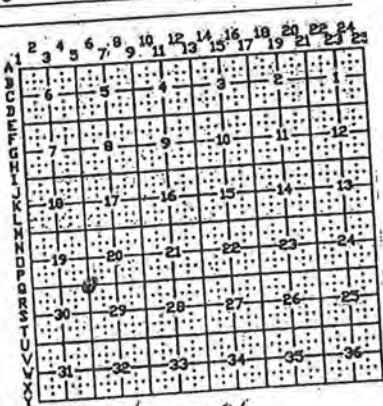RECOVERED BY: NMDATE: 4/1/06
DATE: / /
DATE: / /REFERENCED BY: TDB
G-DBDATE: / / 06
DATE: / /
DATE: / /RECORDED IN PERPETUAL RECORDS BOOK:
BY: Thomas O BubeDATE: 11/1/2006

4/26/06

VII

Wetzel - Voyles
Sec. 19, T-5-S R-4-E

Q-5	CORNER TO	SER.	19, 20, 29 & 30
	RECOVERED	L-STONE SOLID, AND GROUND	0.5 DEG



78. HICKORY STENCE CORNER

15 North 4.5 to center
 Tree w/ T A G
 Old down fence corner post
 15 South 2.0' fence to N.W.
 Stone is 50' + E ast of
 bottom of sink hole
 placed as corner c witness post
 on 3 side of stone

5.4	14.2	Broad	H	L
E.F	5.0	34°	g.	g.
33.0	30 and	527°W	N 60°W	S.S.
FC 12.02	Few	21.7		3 TAG

一

5-U

HARRISON

TX

U-5

TOWNSHIP

5 S

RANGE

4 E

EAST

2ND

PRINCIPAL MERIDIAN

CORNER

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	FROM CORNER?	DISTANCE FROM CORNER	BEARING	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
Common Corner 29-30-31-32	#5 Rebar	T-Post Wood Fence		2.8'	S 41 W	2006		TOB GDB	Sign
	Util. Pole			18.2'	S 74 E				5/68
	Hickory			55.2'	N 18 E				

11 H.H
5/69

AUG 10, 2000

VHM
MAIL
DRAFT

MATERIAL		AREA	
W-7	L-A CONCRETE	R-4 E	
C-1/4	CONCRETE SEC.	32-5-4	
Set # Sby	30" SRC	1" N WEDGE PUNT	
13'	N & Hwy	1'	
142°W	UP w/SIGN	W ENUO 15" CUP	
140.2'			

5/67	CONCRETE SEC.	32 4 33	
W-9 1/4	CONCRETE SEC.	32 4 33	
Set 2 1/2"	MAG MAIL	STATE	
Hwy 11. C	2 DRIVE TO N	E 15' E	
OF DRIVE TO S.	WOOD POST		
WOOD POST	UP w/SIGN	FENCE POST	
S 55'E	N BLOW	N 45'E	
27.2'	23.2'	31.6' N	

5/68	CONCRETE SEC.	22, 32, 31 4 32	wire TICKET
U-5	SET # 5 SRC	20	T
wood	ECOULE "T" POST	S74'E	N 18'E
S 41°W			
2.8'	18.2'	55.2'	

5-1

5-U

5/68

HARRISON COUNTY SURVEYOR
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP: 55 RANGE: 4E SECTION: _____ CORNER REF. I.D. 11-5
 DATE: 8/1/06

MONUMENT INFORMATION

LOCATION: COMMON CORNER 30-29-31-32



DESCRIPTION: # 5 REBAR

ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: YES DATE: / /

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. Wood FENCE T-Post (X)	()	2.8' S 54° W	
2. Utility Pole ()	()	18.2' S 74° E	
3. Hickory w/Wire ()	()	55.2' N 18° E	

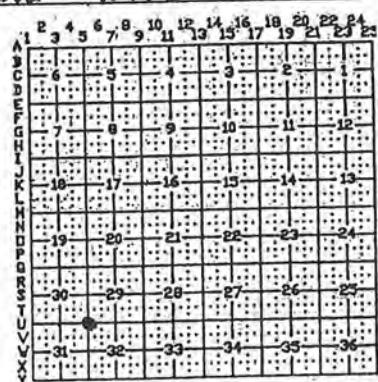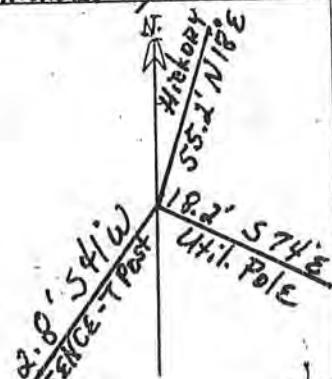

RECOVERED BY: _____

DATE: 8/1/06

DATE: _____

DATE: _____

REFERENCED BY: TDB
GDB

DATE: 8/1/06

DATE: _____

DATE: _____

RECORDED IN PERPETUAL RECORDS BOOK:
 BY: _____

DATE: 8/1/06

5-Y

TOWNSHIP 5-S

RANGE 4-E

PRINCIPAL MERIDIAN

CORNER 5-

Y

CORNER 5-

X

LOCATION	DESCRIPTION OF MONUMENT		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	REFERENCE	OF						
S E Corner SE $\frac{1}{4}$ -SE $\frac{1}{4}$ Section 31	Stone 13" above ground	26" Maple	30' 25"	N80-14"E	11-06-03	T.O.B. J. B.	Bk#4 Pg. 79	Carosite Post, & Signs Placed
	18" Oak	19' 4"		N124-22'E	"	"	"	"
	13.20' OFF- set from corner	5" Maple	8" 5"	N178-35"S	"	"	"	"

5-Y

N

5-Y


11-6-03
SE CORNER SE $\frac{1}{4}$, SE $\frac{1}{4}$
T 55 R 4 E S 31
Carosite Post placed
Signs placed

Harrison County Surveyor
Thomas O. Bube
Deputy Surveyor
Joe Bube

OFFSET CORNER
13.20'

Property OWNER
Richard & Georgette Wimp

5" Maple

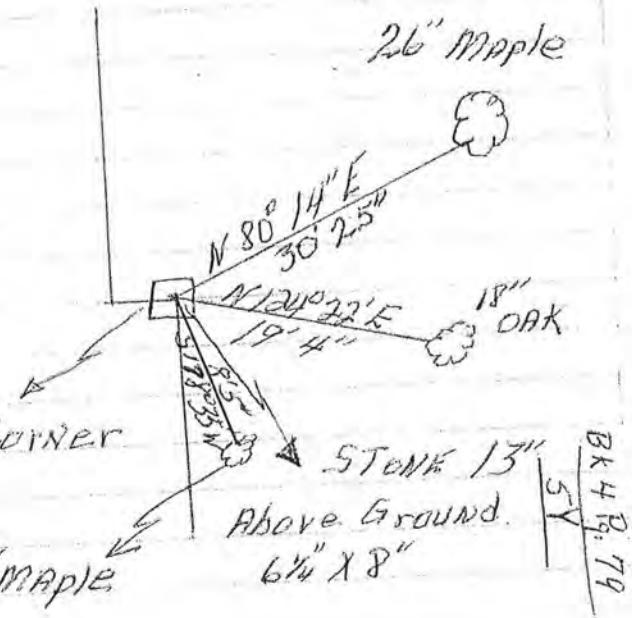

CORNER RECORD

PAGE _____

7-A

HARRISON COUNTY

CORNER 7-A

TOWNSHIP 5 SOUTHRANGE 4 EAST 2 ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
N.E. Cor. N.W. $\frac{1}{4}$ Section 5	Stone	8" Maple	14.74	N.82-38-0W	3-8-82	M.B.	#1 Pg.	70 Sign Placed
		6" Maple	16.80	S26-13-0-W	3-8-82	M.B.		Sign Placed
		7" Maple	39.11	S88-22-0W	3-8-82	M.B.		Sign Placed

7-A

NOEYGEN NO. 385-3

N.E. CORNER NW. 1/4

SS, T55, R4E 7-A

P.

7" & maple nail 1.50' up SOUTH SIDE
8" & maple nail 1.00' up SOUTH SIDE

39.11
S 88° 22' 0" W
14.74
N 82° 38' 0" W

STONE 16.97

STONE is 4" x 6" x 9" out of ground

[] is marked with a metal post

16.80
S 26° 13' 0" W

6" & maple, nail 2.0' up east side

Date 3-8-82

Party Chief M. Brown

Head Chain G. Spears

Rear Chain T. Brown

ALL Trees have a witness sign + red ring, trees have a blaze
with a nail in middle

P46 F72
7-A

7-A

CORNER RECORD

AGE _____

7-G

HARRISON COUNTY

CORNER 7-G

TOWNSHIP 5 SOUTH

RANGE 4 EAST 2 ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
Center Of Section 4	Stone	9" White Oak 12" Ash 7" Beech	7.10' 21.98' 10.25	N31 W N30-30 E S88 E	3-11-81 3-11-81 3-11-81	T. B. T. B. T. B.	#1 PG. 1	

6-7

S8, T55, R4E

89-60.
58-59
71-1

7-G

TW

1/2 section 6-7

CTR Sect. 8 T55, R4E

Beg 10:50 A.M. 3-11-81

end 11:20 A.M.

white oak .75 dia ash .95 dia

7.1' 120-30 21.98
58-59-0
177-58-0

beech 7" dia

all trees are marked
with a 16 penny
clawed head nail
at bottom of Blance

place □ is .45 x .25, is .45 sticking out ground
x in top marked with 1/2" Round bar (south side of stones)

HARRISON

TY

TOWNSHIP 5 S

RANGE 4 E 2ND

PRINCIPAL MERIDIAN

CORNER U-7

7-U

CORNER U-7 TOWNSHIP 5 S

LOCATION	DESCRIPTION OF MONUMENT		REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	OF							
$\frac{1}{4}$ Corner Sec. 29 & 32	# 5 Rebar	Util. Pole	189.8'	S 86 E	2006	TOB GDB	5/69		
		Util. Pole	209.9'	S 89 W					

1944
5/69

Aug 10, 2000

VHM
MAX
DOWN

Milepost	Lat	Long	Area
5 1/66 1/7	42° 5' N	74° 4' E	LACONIA R-4 E
C 1/4 CORNER	32° 5' S	4° 4' E	Sec. 32 - 5 - 4
Set #5 by 30"	1 N	WEDGE POINT	SPC
Set T.	ASH 16'	180'	UP
13° N 4° HWY 11	15° SW	S 18° E	UP
UP w/SIGN	15° SW	S 84° E	SSQ. 30 W
N 42° W	N 17° W	139.9	209.9'
160.2'	16.3'	140.2'	140.2'

[7-1]

U-7 1/4 CORNER TO SEC. 29 + 33
Set #5 SPC 05' of SERTIN ESE

DUM T.

UP

SSQ. 30 W
S 84° E

209.9'

139.9

140.2'

5/67

W-9 1/4 CORNER	Sec. 32 & 33	FENCE POST
Set 2 1/2" NAG	NAG	STATE
HWY 11. C. + DRIVE TO N	E	15° E
OF DRIVE TO S.	WOOD POST	W 48° E
FENCE POST	UP w/SIGN	W 48° E
S S.E.	231' SW	139.9'
27.2'	232'	140.2'

5/68

J-5 Sec.	CORNER 22, 32, 31 & 33	WIRE + CHAIN
Set #5 SPC 00		"
wood FENCE "T" Post w/SIGN	up	
S 41° W	574° E	N 18° E
13.2'	55.2'	2.8'

7-U
 HARRISON COUNTY SURVEYOR ^{5/69}
 CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP. 55 RANGE: 4E SECTION: _____

CORNER REF. I.D. 4-7
 DATE: 8/10/06

MONUMENT INFORMATION

LOCATION: 1/4 CORNER SEC 29-32

DESCRIPTION: #5 REBAR 0.5' S EDGE OF PAVEMENT


ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: () YES DATE: _____

WITNESS MARKERS

TYPE	SIGN BLAZE			ADDITION DESCRIPTION
	()	()	()	
1. Utility Pole	()	()	()	189.8' S 86° E
2. Utility Pole	()	()	()	209.9' S 89° 30' W
3.	()	()	()	

N.
 209.9' S 89° 30' W 189.8' S 86° E
 Utility Pole Utility Pole

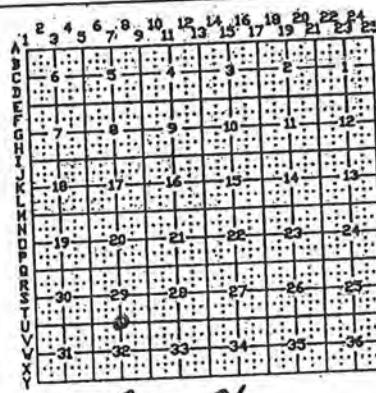

RECOVERED BY: JM

DATE: 8/10/06

DATE: _____

DATE: _____

REFERENCED BY: TOB GDB

DATE: 8/10/06

DATE: _____

DATE: _____

RECORDED IN PERPETUAL RECORDS BOOK:
 BY: _____

DATE: 8/10/06

HARRISON

C. TY

7-W

CORNER W-7

TOWNSHIP 5 S

PRINCIPAL MERIDIAN

RANGE 4 E

2ND EAST

LOCATION	DESCRIPTION OF MONUMENT		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
C $\frac{1}{4}$ Corner Sec. 32	#5 Rebar	Util. Post	16.2'	N 42 W	2006	TOB GDB	5/66	sign
			6.3'	N 17 W				
		Clump						
		16" Ash	51.6'	S18 E				

5/66

W-7
LA CONCIA AREA
L-5-S R-4 E

C 1/4 CORNER Sec. 32 - 5 - 4

Set # Sby 30" SPC 1 N WEDGE POINT

13' N & Hwy 11 ASH

16' UP w/SIGN Hwy 15" Camp

17' N Now 18' E

N 42° W 6.3' 51.60'

140.2' 140.2' 140.2'

W-9 1/4 CORNER Sec. 32 & 33

5/67 Set 2 1/2" NAG INCOR + STATE

Hwy 11 C + DRIVE TO N & 15' E

OF DRIVE TO S. WOOD POST

WOOD POST UP w/SIGN N 48° E

12' N Now 12' N 48° E

S 5' E 23.2' 31.6' 12'

27.2' 27.2' 27.2'

U-5 Sec. CORNER 22, 32, 31 & 32 WIRE
5/68 Set # SPC 20 TICKEY

WOOD POST w/SIGN 574 E N 18° E

S 41' W 13.2' 55.2'

2.8' 2.8'

AUG 10, 2000

VHM
MARK
DWW

144 H

5/69

U-7 1/4 CORNER TO SEC. 29 + 3
SET # SPC 05N + F SOUTH EDGE

PUMT.

UP

16' S 84° E

18' 209.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

189.9'

HARRISON COUNTY SURVEYOR *5/66*
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP: 55 RANGE: 4E SECTION: 32

CORNER REF. I.D.: W.7
DATE: 5/106

MONUMENT INFORMATION

LOCATION: CENTER 1/4 CORNER SEC 32



DESCRIPTION: 77 5 REBAR
63° N Q Hwy. 11

ADDITIONAL DISTINGUISHING CHARACTERISTICS:

SIGN PLACED: () YES DATE: / /

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. 24' 1" Pole	(x)	16.3'	N 43° W
2. Clamp 15"	()	6.3'	N 17° W
3. 10" Ash	()	51.6'	S 18° E

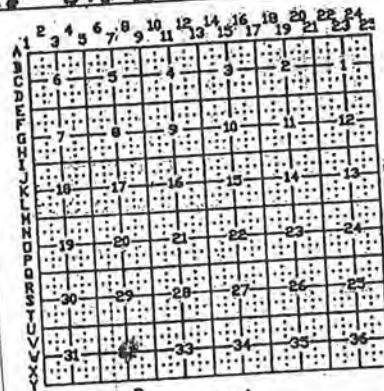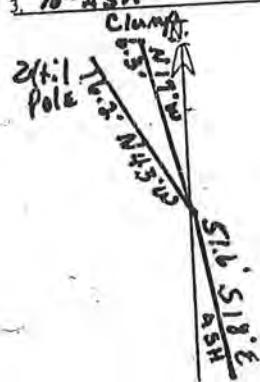

RECOVERED BY: VM

DATE: 5/106
DATE: _____
DATE: _____

REFERENCED BY: TOP
CD 15

DATE: 5/06
DATE: _____
DATE: _____

RECORDED IN PERPETUAL RECORDS BOOK:
BY: _____

DATE: 5/106

8-G

COUNTY

HARRISON

TOWNSHIP 5 S

RANGE 4 E

PRINCIPAL MERIDIAN

CORNER G - 8

LOCATION	MONUMENT	DESCRIPTION OF		DISTANCE FROM REFERENCE POINT	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
		MONUMENT	REFERENCE POINT						
SW Corner SE $\frac{1}{4}$, NE $\frac{1}{4}$ Section 8	Stone	16' W. Oak w/wire	7.7'	N34W (326)	3-25-03	"	MKF M&K	BK 4 pg 80	Carsonite Post placed E edge of Stone
		Beech 8" w/wire w/Harr. Co. sign	10.8'	S83E (97)	"	"	"	"	Stone is in E-W Old wire fence
		Sugar 7"	26.6"	S3E (177)	"	"	"	"	Stone is in NE Corner of open field, 25' SE of Tract Road
								Wt. 6, TOP HCS P-8-05	Heavy Woods, SE, NE, NW of Stone

S 8 T 5 S R 4 E CEN 1/4 COR.

8-G

G-8

N

.15

□ .3

WHITE OAK
WITH WIRE

16"

N34W (32°)

7.7'

BEECH
WITH WIRE

8"

S83E (99)

10.8'

WITH HAR.
CO. SIGN

SUGAR

7"

S3E (17°)

26.6

LIMESTONE AT NE CORNER OPEN FIELD, 25' SE OF E
TRACK RD. HEAVY WOODS SE, NE, & NW OF STN.

CARSONITE POST INSTALLED ON E EDGE OF STONE
STEEL POST WITH "NO TRESPASSING" SIGN ON S EDGE
STONE IS IN E-W OLD WIRE FENCE

CORNER RECORD

PAGE

HARRISON COUNTY

9-A

CORNER 9-A

TOWNSHIP 5 SOUTH

RANGE 4 EAST 2 ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
N.E. Corner N.E. $\frac{1}{4}$ of Section 5	Stone	8" Oak	22.25	East	3-8-82	M.B.	#1 Pg. 67	Sign Placed
		10" Oak	34.61	S65-10 E.	3-8-82	M.B.		Sign Placed
		6" Hickory	29.87	S20-25E	3-8-82	M.B.		Sign Placed

9-A

7-8-82


N N.E. COR. NE $\frac{1}{4}$ OF 55 T 55 R 4 E

P.C. MAY BROWN
 H.G. GREG SPEARS
 M.C. TED BROWN

9-A

133

STONE IS A LIMESTONE ROCK
 WITH A "T" IN TOP.
 $6'' \times 8\frac{1}{2}''$ FLUSH WITH GROUND
 ON EAST SIDE OF A FENCE COR.

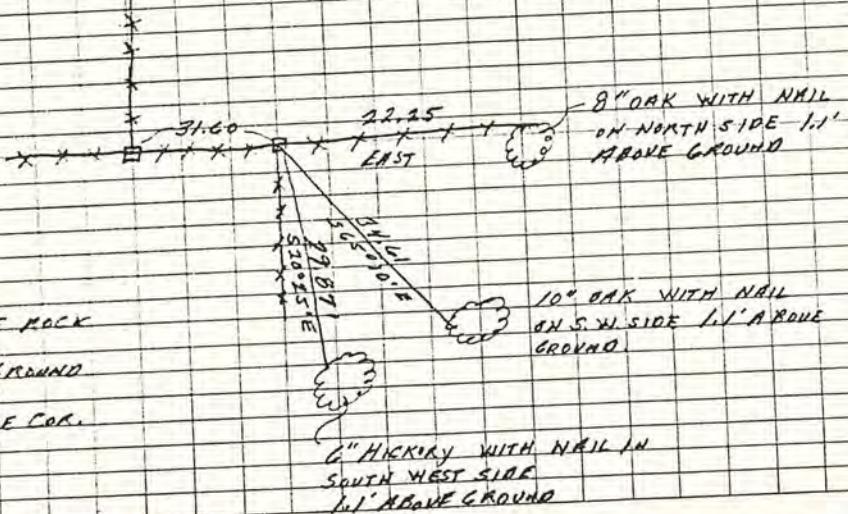

CORNER RECORD

HARRISON

COUNTY

9-C

CORNER 9-C

TOWNSHIP 5 SOUTH

RANGE 4 EAST 2 ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
S.E. Corner N.E. $\frac{1}{4}$ SECTION 5	16d Nail Fence Post	Telephone Pole	62.83	N74-25E	3-8-82	M.B.	#1 Pg. 68	Sign Placed
		2" Dia. Pipe	15.25	S10.5W.	3-8-82	M.B.		Sign Placed
		Woden Post	30.93	S59 W.	3-8-82	M.B.		Sign Placed)

DIETZGEN NO. 385-3


9-8-82

9-C

P.C. MAX BROWN
H.G. GREG SPEARS
R.G. TED BROWN

SE COR. NE $\frac{1}{4}$ 55 T 55 R 4 E

P. 22
9-C

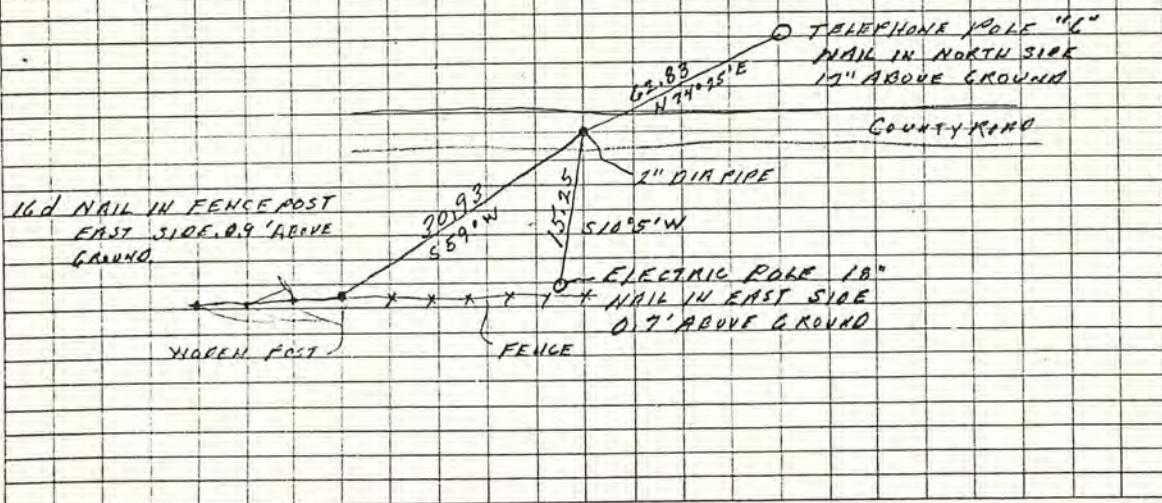

CORNER RECORD

PAGE _____

9-E

HARRISON

COUNTY

CORNER 9-E

TOWNSHIP 5 SOUTH

RANGE 4 EAST 2 ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
S.E. Cor. Sec. 5	Iron Bar	Low Voltage Electric Pole 8" Dia	18.08	N20-55E	3-11-82	M.B.	#1Pg. 72	Sign Placed
		8" Telephone Pole	28.05	S60-W	3-11-82	M.B.		Sign Placed
		18" Electric Pole	24.98	N6-30-W	3-11-82	M.B.		Sign Placed

DIETZGEN NO. 385-3

P.P. MAX BROWN
H.C. GREG SPEARS
R.C. TKA. BROWN

3-11-82

N

S.E. COR. SEC'N 5 T55 R4E

E-9.

9-E

NAIL IN WEST SIDE
2' 4" ABOVE GROUND
HIGH VOLTAGE
ELECTRIC POLE
1' 8" OIA.
2498
N 6° 30' W

3' 4"
NAIL IN WEST SIDE
1' 4" ABOVE GROUND.
LOW VOLTAGE

18.08 17.65
ELECTRIC POLE 8" OIA.
N 20° 55' E
COUNTY ROAD

8" TELEPHONE POLE
NAIL IN EAST SIDE
1' 9" ABOVE GROUND
CORNER IS A IRON BAR
WITH A 1 1/4" SQ. TOP.
6" UNDER ROADWAY

H-24-14
H.R. M.R. NEW P.R.
REFERENCE

LAND CORNER RECORD
(RECTANGULAR SURVEYS)


9-E

Harrison County Surveyor's Reference Index Number: E-9

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 4, 5, 8 and 9

EXISTING SURVEYS

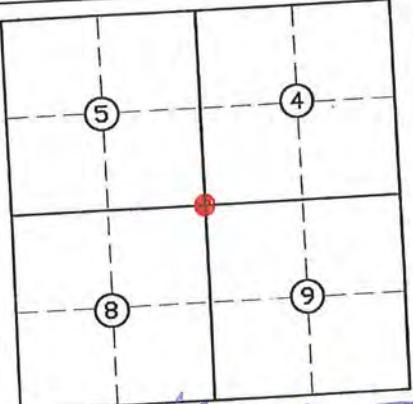Picture/Sketch	Picture/Sketch
	
	
No Original Government Survey Evidence Recovered	Evidence of Subsequent Corner Restoration Found
N/A	<p>Year of search <u>2017</u> By <u>VHM</u> Recovered existing mag nail (by others), 0.6' deep, in St. Michaels Road, 1700'± West of Highway 337 at NW corner of house lot in North/South power line.</p>
	<p>Perpetuation Record</p> <p>Monument and accessories established. Include brief description of area. <u>Replaced mag nail with #5 X 0.8', 0.6' deep with mag hub set in concrete plug over monument.</u> The corner position is supported by very old and prominent cultural features in the vicinity and by measurements to adjacent corners. Corner accessories established:</p> <p><u>Utility Pole, Overhead Electric North/South, N 3° W, 24.92', double headed nail + 2.5' on West side.</u></p> <p><u>Utility Pole, with transformer, Overhead Electric East/West, N 26° W, 17.70' MN + 1.5' on West side.</u></p> <p><u>Utility Pole with USD, S 39° E, 33.65', MN + 0.3' on North side.</u></p> <p><u>Utility Pole, S 62° W, 28.07', double headed nail + 2' on East side.</u></p> <p>N: 1038139.3 E: 206992.2</p> <p>Signature <u>VHM</u> Date: <u>07/28/2017</u></p> <p><i>Mark G. Klundt, Surveyor 8/8/17</i></p>


LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County No. E-9

9-E

T 5 S R 4 E 2nd Mer., County Harrison State IndianaSection Corner common to Sections 4, 5, 8 and 9

EXISTING SURVEYS

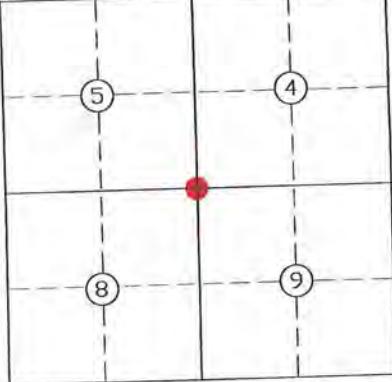No Original Government Survey Evidence Recovered	Picture/Sketch N/A
Subsequent Corner Restoration Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc..)	Evidence of Subsequent Corner Restoration Found Year of Search <u>2014</u> by <u>VHM</u> <u>Recovered PK nail over reading, 0.65' deep.</u>
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	
 Signature <u>Virt H. M.</u> Date: <u>Dec. 08, 2014</u> <u>Worobay & Klemmick 2014</u>	Perpetuation Record Monument and accessories established. Include brief description of area. <u>Monument is situated in centerline of Michael Road. Corner accessories established:</u> <u>Utility Pole, S 60° W, 28.1' with existing witness sign</u> <u>Power Pole, N 4° W, 24.9' with existing witness sign</u> <u>Power Pole w/transformer, N 26° E, 18.1' with existing witness sign.</u> <u>Maple 34", S 68° E, 44.8", unmarked</u> <u>Maple 27", S 27° E, 45.5", unmarked.</u> N: 1038139.3 E: 206992.2

CORNER RECORD

AGE

9-T

HARRISON COUNTY

CORNER 9-T TOWNSHIP 5 SOUTH RANGE 4 EAST 2 ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF MONUMENT	REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
S.E. Corner Section 8	3" dia. Alum. Cap Buried Cable Post	Unitily Pole Buried Cable Post	23.60 26.20	N. 9 W N. 67E	3-12-81 3-12-81	T. B. T. B.	#1 P6.2 16p Nail South Side 16p Nail South Side	

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County No. I-9

9-I

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 8, 9, 16 and 17

EXISTING SURVEYS

No Original Government Survey Evidence Recovered	Picture/Sketch
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc..)	Year of Search <u>2014</u> by <u>VHM</u>
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	
	<p>Perpetuation Record</p> <p>Monument and accessories established. Include brief description of area. <u>Recovered aluminum monument with 3½" aluminum cap stamped to depict the corner position. Monument is situated in West side of turn in Road (Melview Road), 4' West of centerline to South, 4' North of centerline to East. Corner accessories established: Power Pole, N 5° W, 24.5' with witness sign. Wood Post guard to telephone cable box, N 73° E, 26.5', unmarked.</u></p> <p>N: 1032793.5 E: 207127.5</p> <p><i>David H. M.</i> Signature</p> <p>Date: <u>Dec. 08, 2014</u></p> <p><i>David H. M.</i> Handwritten 2014</p>

I-9 9-I

DITZGEN NO. 395.3

T 55, R 4 E

S.E. corner S.S.

150-051

16 P nail south side
electric pole

N

COR

R 4 E

0-51

more

lumber supply post

16 P nail south side

electric pole

just below top branch

16 P

nail south side

electric pole

16 P

nail south side

electric pole

58 \$9

512 \$16


CORNER 9-MTOWNSHIP 5 SouthRANGE 4 EAST 2ND

PRINCIPAL M.L. INDIAN

9-M9-M

LOCATION	DESCRIPTION OF MONUMENT	REFERENCE	DISTANCE FROM CORNER?	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
N W Corner Sec. 21	5/8 Re-Bar	10" Sassa.	52.22	S 111 E	6-17-03	SP # 3	# 4 Page 73	
	Wooden Post	16.65		N 351 W	6-17-03	SP # 3		
	18" Maple	41.56		S 244 W	6-17-03	SP # 3		
	Gate Post	17.30		S 180	6-17-03	SP # 3		

9-11

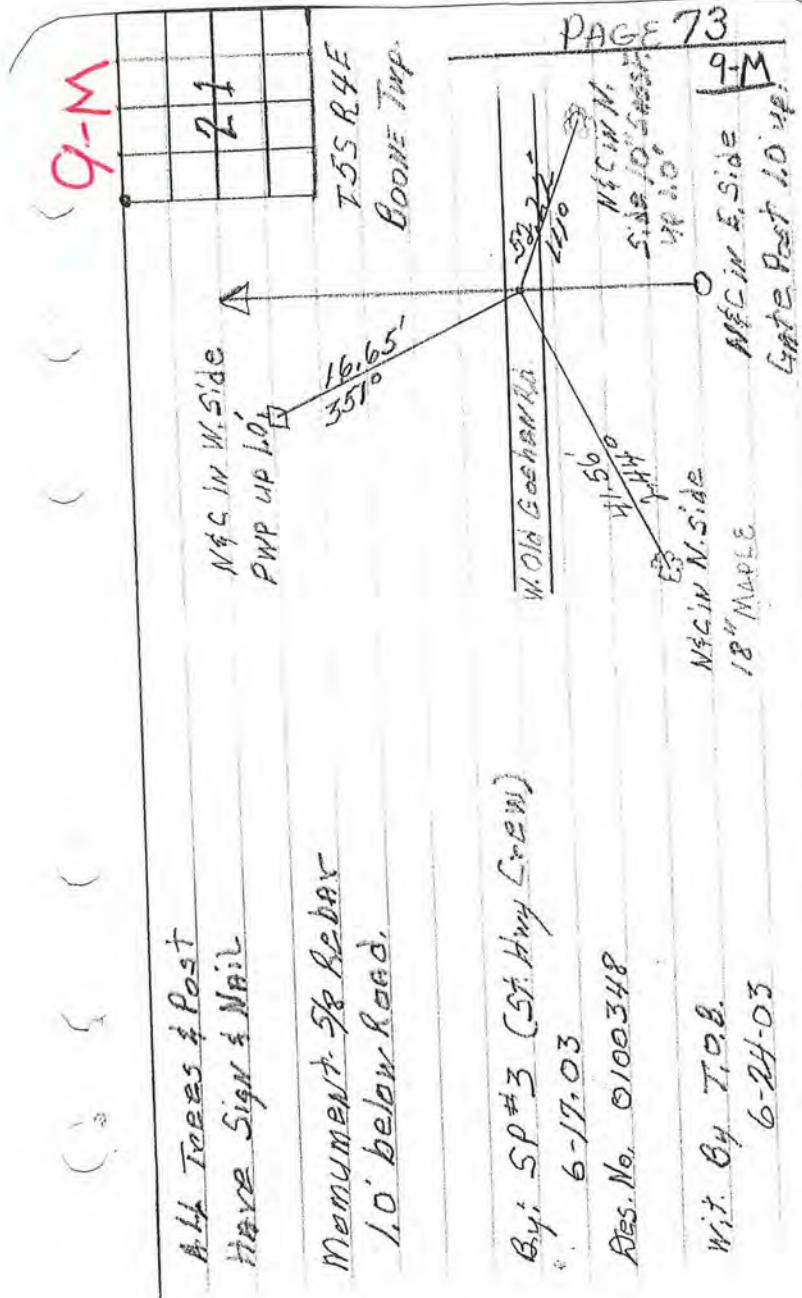

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County No. U-9

9-U

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 28, 29, 32 and 33

EXISTING SURVEYS

No Original Government Survey Evidence Recovered	Picture/Sketch
See survey recorded in Legal Survey Book 3, Page 18.	N/A
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc..)	Year of search <u>2014</u> By <u>VHM</u> <u>Recovered Railroad Spike 0.1' deep.</u>
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	
	<p>Perpetuation Record</p> <p>Monument and accessories established. Include brief description of area. <u>The monument was left in place as recovered.</u> The monument is situated in centerline-centerline of Tobacco Landing Road and Hooptown Road.. Corner accessories established: <u>Utility Pole with underground drop, N 45° E, 26.80' to mag nail 0.6' up in Southeast side.</u> <u>Stop Sign, S 74° W, 27.78'. with Harrison County Surveyor's sign.</u> <u>Utility Pole, N 33° W 24.80' to mag nail 1.0' up in Southwest side.</u></p> <p>N: 1016802.49 E: 207432.50</p> <p>N: 1016748.90 { NGS Station Angle E: 207526.31 { JA0450</p> <p>Signature <u>V.H.M.</u> Date: <u>10/08/2014</u></p> <p><u>Harold K. Linsenmeyer</u> 2014</p>

9-W

HARRISON

TY

CORNER W-9

TOWNSHIP 5 S

RANGE 4 E 2ND

PRINCIPAL MERIDIAN

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
$\frac{1}{4}$ Corner Sec. 32 & 33	2 $\frac{1}{4}$ " Mag. Nail.	Wood Fence Post	27.2'	S 5 E	2006		TOB GDB	5/67
	Util. Pole		23.2'	N 31 W				
		Wood Fence Post	31.6'	N 48 E				Sign

9-W

5/69

HARRISON COUNTY SURVEYOR
CORNER MONUMENT RECOVERY & REFERENCE RECORD



TWNSHIP: 5 S RANGE: 4 E SECTION: _____CORNERS REF. LD.: W-9
DATE: 8 / 106MONUMENT INFORMATIONLOCATION: 1/4 CORNER SEC 32 + 33DESCRIPTION: 2 1/2" MAG. Nail

ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: () YES DATE: _____

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. WOOD FENCE	()	()	31.2' S 6° E
2. MET. Pole	(X)	()	31.2' N 31° W
3. WOOD FENCE Post	()	()	31.6' N 48° E

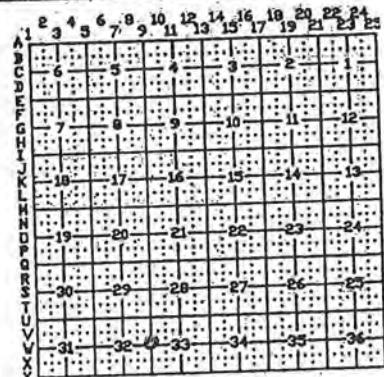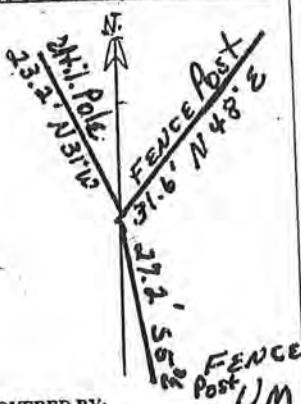

RECOVERED BY: _____

DATE: 8 / 106

DATE: _____

DATE: _____

REFERENCED BY: TDB
DOBDATE: 8 / 106

DATE: _____

DATE: _____

RECORDED IN PERPETUATION RECORDS BOOK:

BY: _____ DATE: 8 / 106

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County Surveyor's Reference Index Number: 13-A

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 3 and 4

EXISTING SURVEYS	
Picture/Sketch	Picture/Sketch
<p>Fence Corner</p> <p>S 59°26'05" W 31.46'</p> <p>6" cedar up 1.4'</p> <p>8" poplar up 1.8'</p> <p>S 02°40'40" W 13.30'</p> <p>6" dogwood up 1.5' S 74°24'30" E 18.08'</p>	
No Original Government Survey Evidence Recovered	Evidence of Subsequent Corner Restoration Found Year of search <u>2018</u> By <u>WPM</u>
<p>NW Corner NW $\frac{1}{4}$ Section 3-5-4</p>	<p>Existing Section Corner Notes References for: NW Corner NW $\frac{1}{4}$ Section 3-5-4</p> <p>Fence Corner See Primavera & Assoc. surveys Ref. #1 = Sign in Northeast side of 6" cedar Tree 1.4' up S 59-26-05 W, 31.46' Ref. #2 = Sign in North side of 8" poplar Tree 1.8' up S 02-40-40 W, 13.3' Ref. #3 = Sign in West side of 6" Dogwood Tree 1.5' up S 74-24-30 E, 18.08'</p> <p>ISPCS-EZ-U.S.Survey Feet N: 1043450.79 E: 212297.09</p>
<p>Signature <u>John McCall</u></p> <p>Date: <u>10/5/18</u></p>	

LAND CORNER RECORD
(RECTANGULAR SURVEYS)


13-E

Harrison County Surveyor's Reference Index Number: E-13

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 3, 4, 9 and 10

EXISTING SURVEYS

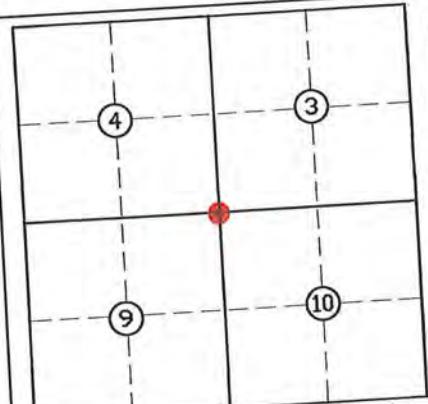Picture/Sketch	Picture/Sketch
	
No Original Government Survey Evidence Recovered	Evidence of Subsequent Corner Restoration Found
N/A	Year of search <u>2017</u> By <u>VHM</u> Recovered existing mag hub near centerline of East/West crushed stone road at fence lines North and South.
	<p style="text-align: center;">Perpetuation Record</p> <p>Monument and accessories established. Include brief description of area. Replaced mag hub with #5 X 30" rebar with 3/4" aluminum cap stamped to depict the corner position. The corner position is supported by very old and prominent cultural features in the vicinity and by measurements to adjacent corners. Corner accessories established: Sugar, 5", N 15° E, 11.47' with Harrison County Surveyor's sign, MN + 0.4' on East side.</p> <p>W. Oak, 12", South, 13.93', MN + 0.3' on West side.</p> <p>Hickory, 19", N 19° W, 24.40', MN + 1.0' on East side.</p> <p>Carsonite Post, South, 7.5'</p> <p>N: 1038014.75 E: 212290.78</p> <p>Signature <u>Vincent H. M.</u></p> <p>Date: <u>01/28/2017</u></p> <p><i>Mark D. Pleasance Surveyor 81817</i></p>

13-I

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County Surveyor's Reference Index Number: I-13

T 5 S R 4 E 2nd Mer. County Harrison State IndianaSection Corner common to Sections 9,10,15 and 16

EXISTING SURVEYS

No Original Government Survey Evidence Recovered See survey recorded in Instrument Number 201206841.	Picture/Sketch 
Subsequent Corner Restoration Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc...)	Evidence of Subsequent Corner Restoration Found Year of search <u>2015</u> By <u>VHM</u> Recovered reading in pavement.
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	Perpetuation Record Monument and accessories established. Include brief description of area. <u>Replaced reading in pavement with #5 by 0.8', 0.6' deep. Set mag hub in concrete plug over monument. Corner accessories established:</u> <u>Concrete R.O.W. Monument, back of centerline N 24° W, 49.1'</u> <u>Utility Pole, S 2° E, 29.48', with Harrison County Surveyor's sign, MN</u> <u>+ 0.5' top nail.</u> <u>East End CMP, N 22° W, 22.88', 45 cal. drill hole.</u> N: 1032685.9 E: 212427.9
Diagram of a rectangular section corner with vertices labeled 9 (top-left), 10 (top-right), 15 (bottom-right), and 16 (bottom-left). A red dot marks the common corner point.	Signature <u>Vinh H.M.</u> Date: <u>11/02/15</u>

13-M

COPNER 13-M TOWNSHIP 5S

PRINCIPAL M-INDIAN

RANGE 4E

EAST



2ND

D

LOCATION	DESCRIPTION OF MONUMENT		DISTANCE FROM CORNER?	BEARING FROM CORNER?	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
NE Corner Sec. 21	R.R. Spike	NW Corner Block Bldg.	72.11'	240° W	6-17-03	TOB	#4 pg 75	S. Harr. Water Corp. Bldg.
		N E Corner Block Bldg.	48.96'	218° W	6-17-03	TOB	#4pg .75	
		Fire Hyd.	80.96'	247° W	6-17-03	TOB	"	
		18" Cedar N&C W. side 1" up	18.25'	6° E	6-17-03	TOB	"	

13-M

NE Corner
Sec. 16 T.55 R.45
Boone Tape

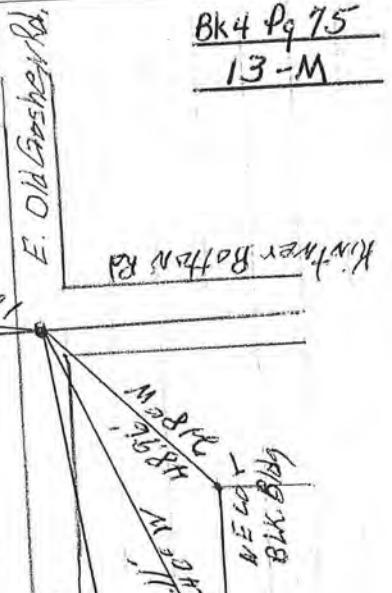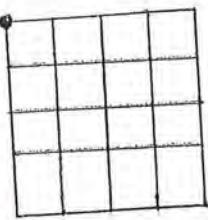

RR Spike
1.0' below Road Surface Top Len. 80.96'
St. Surveyor Sp #3 F. Hupp
City Surveyor Tom Bube
6-17-03
E.S. No. 0100348
Larmer
B.I.K. Bldg

Bk 4 Pg 75
13-M

01206841 CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County No. M-13

13-M

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 15, 16, 21 and 22

EXISTING SURVEYS

No Original Government Survey Evidence Recovered	Picture/Sketch
See Survey recorded as Instrument Number 201206841.	N/A
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc..)	Year of search 2014 By VHM Recovered railroad spike.
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	
	Perpetuation Record Monument and accessories established. Include brief description of area. Set #5 x 12" rebar, 0.6' deep with mag hub set in concrete plug over monument. The monument is situated in centerline-centerline of Old Goshen & Kintner Bottom Roads. Corner accessories established: Cedar 20", N 4° E, 18.04' to mag nail 0.8' to bottom nail in Harrison County Surveyor's sign. Wood Teleped Post, N 66° E, 29.72' to mag nail 1.0' up in North side. Stop Sign, S 22° E, 41.00'. Northeast Corner of Water Building, S 38° W, 48.92'. <p>N: 1027354.00 E: 212522.71</p> <p>Signature <u>Virt H. M.</u> Date: <u>Nov. 06, 2014</u></p> <p>Harold L. Kintner 2014</p>

13-0

CORNER 13-0 B-0

TOWNSHIP 5S

RANGE 4E

PRINCIPAL MEADIAN

2ND

EAST

LOCATION	DESCRIPTION OF MONUMENT		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	REFERENCE	MONUMENT						
NE 1/2 Corner Section 21 Boone Twp.	P K Nail	15" Red Bud N&C W. Side up 1'	27.70'	151° E	6-17-03	SP #3 TOB	Bk 4Pg 6	Sign Placed
		15" Cedar N&C S. Side 1.0 up		93° E	6-17-03	TOB SP#3	"	Sign Placed
		10" Pers. N&C N. Side 1.0 up	21.60"	311° W	6-17-03	SP #3 TOB	"	Sign Placed

13-0

Sec 21 T55 R4E

Bonne Trap.

NE 1/4 corner

10' pers.

PK Nail & Rd.


Flush w/ Print.

St. Surveyor Sp#3

City Surveyor Tan Bube

6-19-03

Res. No. 0100348

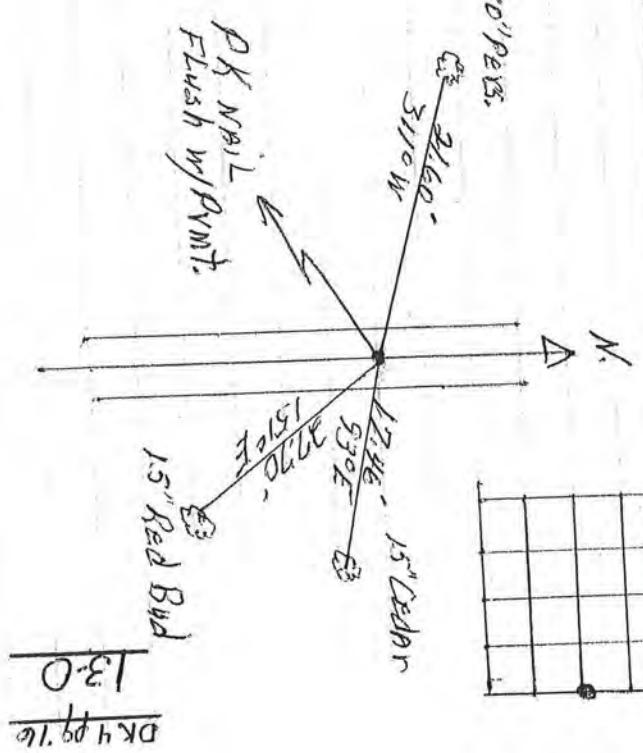

13-0
DK 49 16

ALL signs placed

COPNER 13-Q

TOWNSHIP 5S

RANGE

2ND

PRINCIPAL ME-M-DIAN

13-Q

13-Q


LOCATION	DESCRIPTION OF MONUMENT		DISTANCE FROM CORNER?	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	REFERENCE	MONUMENT						
S E Corner Section 21	1" Pipe Electric Pole	12" Cedar 173'	28-E 174"	0°-E 0-N	6-17-03 6-17-03	TOB TOB	#4 Pg 744 " "	sign place sign place
	5/8 rebar	132'	13-20'		6-17-03	TOB	"	

13-Q

13-Q ELECT Pile
m' marker

Ac. 21 T 55 R 4E
SE CORNER
BOONE Twp.

Dir. Dr. To
99.75' Slinger
Bottom Rd.

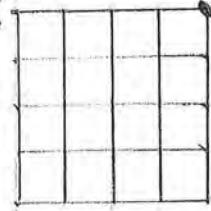

State Surveyor #3
Thomas O. Bush
City Surveyor
6-17-03

(Nora)
1" pipe
1" King.

#4 - Pg 74
13 Q

N-7795.4860
E. 12698.6039

Res. No: 0100348

CORNER RECORD

PAGE _____

16-Y

HARRISON COUNTY

16-Y


CORNER 16-Y

TOWNSHIP 5 SOUTH

RANGE 4 EAST 2 ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
S.E. Corner S.W. $\frac{1}{4}$ S.E. $\frac{1}{4}$ Section 34	Alumm Plate	Utility Pole	45.85	N 82W	4-12-81	T.B.	#1 PG. 14	Signs Placed
		Fence Corner	81.65	N 58W	4-17-81	T.B.		Signs Placed
		Fence Corner	66.68	North	4-17-81	T.B.		Signs Placed

16-Y

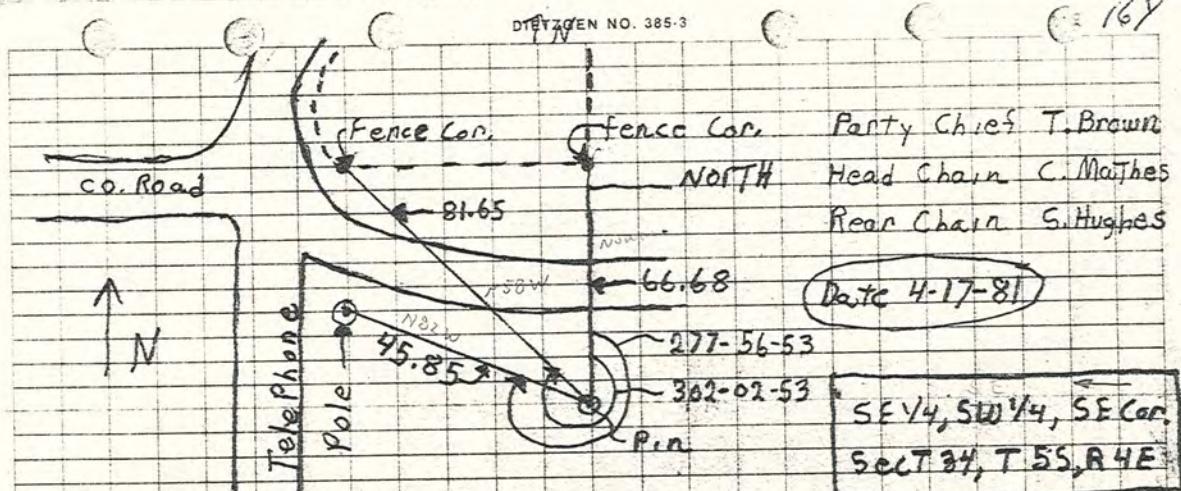

P.in is a 5/8" Rebar with a column. Cap (.30" dia), P.in is marked with a metal Post with Sign.

The fence corners + telephone pole have column. nail 1.00' off ground. They also have WITNESS signs.

The nail, + 6.00' off ground on F.cor + Pole is painted Red

16-Y

LAND CORNER RECORD
(RECTANGULAR SURVEYS)



Harrison County No. E-17

17-E

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 2, 3, 10 and 11

EXISTING SURVEYS

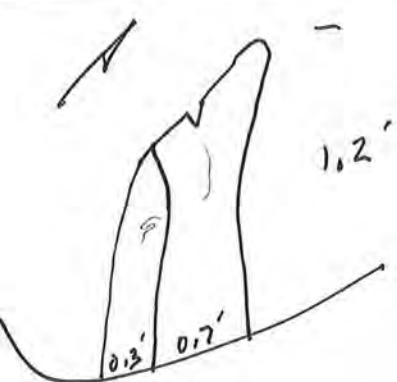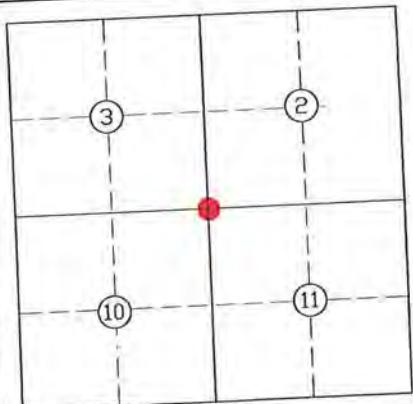No Original Government Survey Evidence Recovered		Picture/Sketch 
Subsequent Corner Restoration Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc...)</small>		Evidence of Subsequent Corner Restoration Found Year of search <u>2014</u> By <u>VHM</u> <u>Recovered pinnacle limestone projecting 1.2'.</u>
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____		Perpetuation Record Monument and accessories established. Include brief description of area. <u>Placed a cairn of rocks around the stone, old down fence in all cardinal directions. Monument is situated in woods. Corner accessories established:</u> <u>Fence corner post, North 1.5'.</u> <u>Ash 8", S 58° W, 3.1' with 3 hacks and Harrison County Surveyor's sign.</u> <u>W. Oak 13", S 28° W, 7.0'.</u> <u>Nature Conservancy sign with steel post, N 75° w, 1.6'.</u>
Signature <u>Vick H. M.</u> Date: <u>Dec. 08, 2014</u> <u>Harold H. Huston 2014</u>		

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

17-1

Harrison County Surveyor's Reference Index Number: 17-1
T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 10 and 11

EXISTING SURVEYS

Picture/Sketch	Picture/Sketch
<p>No Original Government Survey Evidence Recovered</p>	<p>Evidence of Subsequent Corner Restoration Found</p> <p>Year of search <u>2018</u> By <u>WPM</u></p>
<p>SE CORNER OF SECTION 10</p>	<p>Existing Section Corner Notes Reference for: SE Corner of Section 10</p> <p>Monument and accessories established. Include brief description of area. Existing railroad spike found in cl S.R. 11</p> <p>Ref #1= orange surveyors post N 01 E, 45.5 ft</p> <p>Ref #2= concrete R/W marker S 26 E, 37.4 ft</p> <p>Ref #3= sign in north side of pwp bottom nail 2.3 ft up S 10 E, 94.3 ft</p> <p>Ref #4= sign in north side of pwp 2.3 ft up S 6 W, 200.1 ft</p>
<p>Signature <u>William McCollum</u></p> <p>Date: <u>10/5/18</u></p>	<p>ISPCS-EZ-U.S.Survey Feet N: 1032595.03 E: 217709.24</p>

LAND CORNER RECORD
(RECTANGULAR SURVEYS)


Harrison County Surveyor's Reference Index Number: I-17

17-I

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 10, 11, 14 and 15

EXISTING SURVEYS

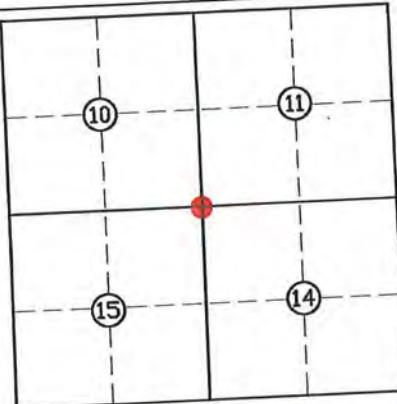Picture/Sketch	Picture/Sketch
	
No Original Government Survey Evidence Recovered See survey recorded in Survey Book 3, Page 329 and Instrument Numbers 98054138 and 20001042.	Evidence of Subsequent Corner Restoration Found Year of search <u>2017</u> By <u>VHM</u> <u>Recovered reading in centerline of State Highway 11.</u>
	<p>Perpetuation Record</p> <p>Monument and accessories established. Include brief description of area. Set a railroad spike over reading. The corner position is supported by very old and prominent cultural features in the vicinity and by measurements to adjacent corners. Corner accessories established:</p> <p>Fence Corner with carbonite post, N 5° W, 45.65', Water Meter, N 32° E, 31.51'. Steel pin with cap (by McCauley & Company), S 70° W, 86.2'. Right of Way Monument, S 34° E, 37.13', back centerline.</p> <p>N: 1032595.30 E: 217708.70</p> <p>Signature <u>Vick H. M.</u> Date: <u>07/20/2017</u></p> <p><i>Philip K. Kuntz Surveyor 8-8-17</i></p>

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County No. M-17

17-M

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 14, 15, 22 and 23

EXISTING SURVEYS

No Original Government Survey Evidence Recovered	Picture/Sketch
N/A	N/A
Subsequent Corner Restoration	
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc...) _____	Evidence of Subsequent Corner Restoration Found Year of search <u>2014</u> By <u>VHM</u> <u>Recovered Railroad Spike.</u>
Bearing Trees, Reference Objects	
Species _____ Diameter _____ Bearing _____ Distance _____	
	<p>Perpetuation Record Monument and accessories established. Include brief description of area. <u>The monument was left in place as recovered. The monument is situated near centerline East Old Goshen Road at Southeast corner.</u> <u>Cultivated field and residence to Northeast, 12'± West centerline of crushed stone drive to North.</u> Corner accessories established: <u>Old Fence Post, N 1° E, 20.4'.</u> <u>North end of 18" CMP, N 54° W, 18.92', 45 cal. hole near each end of pipe.</u> <u>South end of 18" CMP, S 20° E, 20.50'.</u> <u>Water Meter, Residence # 4010, N 58° E, 37.8'.</u></p> <p>N: 1027258.54 E: 217766.40</p> <p>N: 1016748.31 { NGS Station Angle E: 207526.82 { JA0450</p> <p><i>Carol ZK Kristensen 2014</i></p>
Signature <u>Vick M.M.</u> Date: <u>10/08/2014</u>	

HARRISON

CITY

CORNER R-17

TOWNSHIP 5 S

RANGE 4 E 2ND

PRINCIPAL MERIDIAN

17-R

17-R

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE					
N 1/16 Corner Sec. 26-27	Fence Corn.	Stone	0.7'	West	2006	TOB GDB	5/72

17-R

5/

HARRISON COUNTY SURVEYOR 72
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP: 5 S RANGE: 4 E SECTION:

CORNER REF. I.D.: R-17
DATE: 3 / 105

MONUMENT INFORMATION

LOCATION: 1/4 CORNER SEC. 26 + 27

DESCRIPTION: STONE


ADDITIONAL DISTINGUISHING CHARACTERISTICS:

SIGN PLACED: () YES DATE: / /

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. FENCE CORNER	()	0.7' W	
2. REBAR	()	0.5' E	
3.	()		

N.
0.7' W 0.5' E
FENCE CORNER REBAR

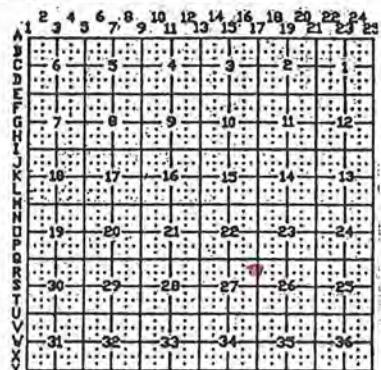

RECOVERED BY: JM

DATE: 3 / 105

DATE: / /

DATE: / /

REFERENCED BY: TOB
G-AB

DATE: / / 06

DATE: / /

DATE: / /

RECORDED IN PERPETUATION RECORDS BOOK:
BY: _____

DATE: / /



LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County No. U-17

17-U

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 26, 27, 34 and 35

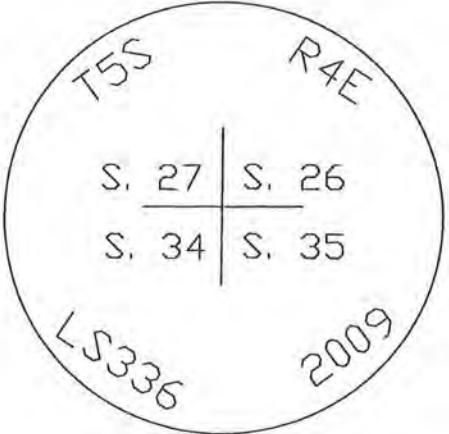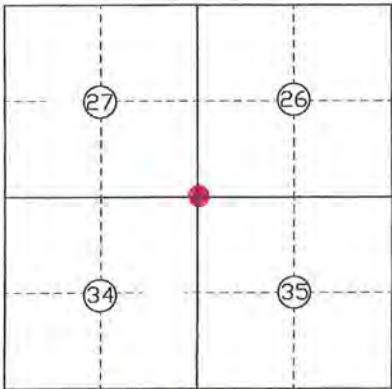EXISTING SURVEYS	
No Original Government Survey Evidence Recovered	Picture/Sketch
See survey recorded in Legal Survey Book 3, Page 43 and Instrument Number 200905081.	
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc...)	Year of search <u>2014</u> By <u>VHM</u>
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	
	<p>Perpetuation Record Monument and accessories established. Include brief description of area. <u>Reset #5 x 30" pin with 3 1/4" aluminum disk, stamped to depict the corner position, at 90° bend in crushed stone access road 1/8 mile East of 90° bend in County paved road. Set carsonite post 0.5 feet East. No accessories available.</u></p> <hr/> <p>N: 1016597.16 E: 217930.68</p>
Signature <u>V.H.M.</u>	
Date: <u>10/09/2014</u>	<u>Mark H. Minton</u> 2014

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____

Harrison Co. No. Y-17


17-Y

T 5 S R 4 E 2nd Mer. County Harrison State Indiana

Section Corner common to sections 34 & 35

EXISTING SURVEYS

Original Government Survey		Original Evidence Found
Year surveyed <u>N/A</u> Original monument _____ <small>(wood post, stone, pile of stones, etc.)</small>		Year of search <u>N/A</u> By _____ Monument found _____
Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____		Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____
Subsequent Corner Restoration		Evidence of Subsequent Corner Restoration Found
Year surveyed <u>N/A</u> By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc...)</small>		Year of search <u>1980-2011</u> By <u>VHM</u> Recovered #4 steel pin with "T" post 0.5' Northeast. See Survey Book 1, Oversize documents #02849 (Herb Fredricks) and #02863 (Dr. Gerald Yarnell).
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____		

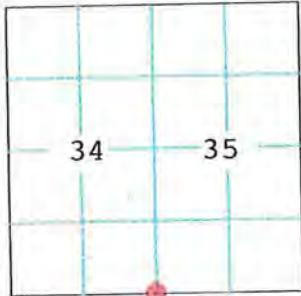

At time of search:

1. Did you have the record description? Yes X No _____

2. How was search area located?
pacing, chaining, photo, maps,
etc. SURVEYING

3. Man hours spent in search N/A

4. Do you think additional search might recover evidence? Yes _____

No X

5. Signature Vict H. May

Relation of Evidence to Record Features Along Section Lines
Section line to sections _____
Object _____
Record Distance _____
Measured Distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any _____

Perpetuation Record

Monument and accessories established. Include brief description of area. The pin was left in place as recovered.

W. Oak	R. Oak	Sugar	Carsonite
16"	16"	9"	Post
N 53° W	N 89° E	S 3° E	North
13.88'	12.30'	19.15'	0.5'
Mag Nail + 0.5'	Mag Nail + 0.5'	Mag Nail + 0.5'	
In NE crown	On S. side W/Sign	In West crown	

Certified corner restoration certificate prepared Yes No X

Filed in county records at _____ Date _____ County No. _____

Identified on aerial photo No. _____ Which is filed at _____

ISPCS East Zone 1983 Datum (2011) USSF



N: 1011266.2 E: 218094.2

CORNER RECORD
(RECTANGULAR SURVEYS)

17-Y

Harrison County No. Y-17 - A-17

T 5 S R 4 E 2nd Mer., County Harrison State IndianaSection Corner common to Sections 34 & 35, T-5-S, R-4-E and Sections 2 & 3, T-6-E, R-4-E

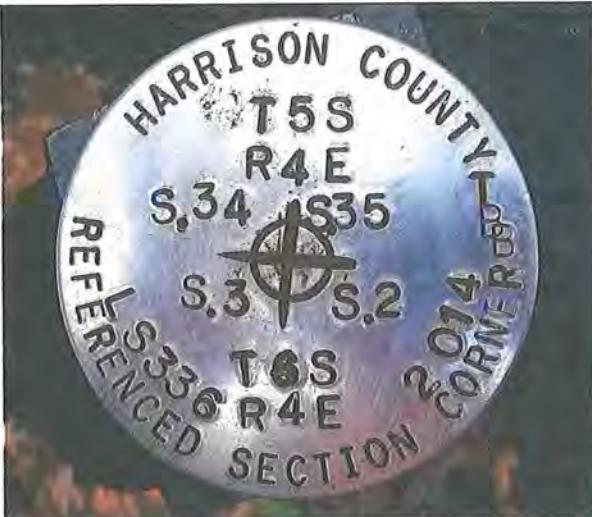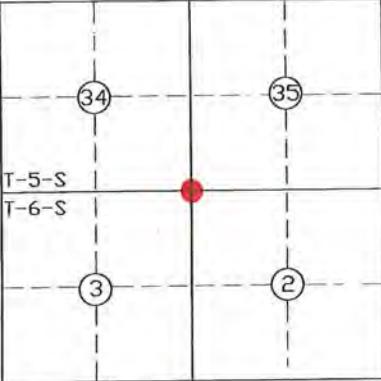EXISTING SURVEYS	
No Original Government Survey Evidence Recovered	Picture/Sketch
See Survey recorded in Survey Book 1, oversized Document 02849 and 02863 and as Instrument Number 201101613.	
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc...)	Year of search <u>2014</u> By <u>VHM</u> <u>Recovered #4 projecting 1.0' with carbonite post & "T"</u> <u>post with Harrison County Surveyor's sign.</u>
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	
 Signature <u>Vick H. M.</u> Date: <u>Dec. 08, 2014</u>	Perpetuation Record Monument and accessories established. Include brief description of area. <u>Replaced monument with #5 x 24" rebar with 3 1/4" aluminum disk stamped to depict the corner position. Set carbonite post North 0.5°, metal post with sign South 1/2° and "T" post with sign Northeast 1/2°. The monument is situated in prominent North-South, East-West cultural intersection. Monument is also in a ditch.. Corner accessories established:</u> <u>W. Oak 18, N 62° W, 13.95' to mag nail 1/2' up in Northeast side,</u> <u>Red Oak 19", N 85° E' 12.28' to mag nail 1/2' up in Southeast side with Harrison County Surveyor's sign.</u> <u>Hickory 10", S 4° E, 19.5' to mag nail 1/2' up in Southwest side.</u> N: 1011266.2 E: 218094.2 <i>Hawbaker Antwer 2014</i>

CORNER RECORD

PA

18-A

HARRISON COUNTY

CORNER 18-A

TOWNSHIP 5 SOUTH

RANGE 4 EAST 2 ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF		DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
	MONUMENT	REFERENCE						
N.E. Corner N.W. $\frac{1}{4}$ of N.W. $\frac{1}{4}$ Section 2	Stone	6" Shell- bark Hickory	18.0	S 4-27E	3-27-81	T.B.	#1 PG. 6	Sign Placed
		24" Maple	2.12	N 74-50E	3-27-81	T.B.		Sign Placed
		Fence Corner	2.23	West				
		Fence Corner	55.23	West				

18-A


18-A

MATZGEN NO. 385.3

Trees have blaze marks,
blaze marks have alum.
nails in middle.

Party Chief T. Brown
Head Chain C. Matthes
Rear Chain S. Hughes

MA 6. North

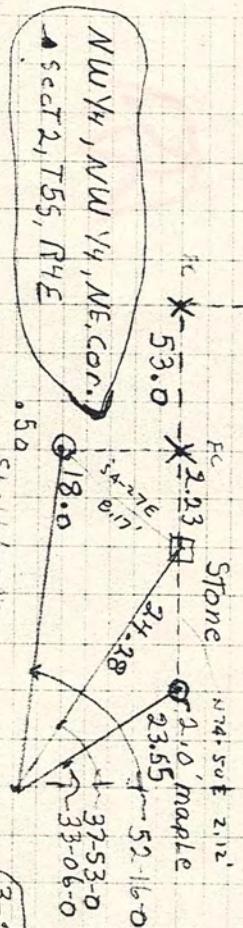

Hickory

Stone is 20' out of ground, stone is painted red, & marked on north side with #5 R.B., pin is flush with ground

HARRISON

XIV

18-1

CORNER 18-U

TOWNSHIP 5

FLANGE

PRINCIPAL MERIDIAN

2ND

EAST

42

RANGE

PRINCIPAL MERIDIAN

2ND

EAST

42

RANGE

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
N.E. Corner NW $\frac{1}{4}$, NW $\frac{1}{4}$ Sec. 35	Stone out of Ground marked metal post	0.50 Persim- mon	8.15	N13-52-0E	6-26-90	T.B.	#4 Pg. 16	Sign placed
	1.0' Maple		8.10	S34-52-0E	6-26-90	T.B.		Sign placed
	0.80' Sassafras		12.0	South	6-26-90	T.B.		Sign placed

18-U

DITZGEN NW 3853

STONE is 0.30 x 0.20 x
0.60 out of ground
STONE is marked with a
metal Post + sign

6-26-90

NE corner, NW 1/4, NW 1/4
Sect. 35, T 55, R 4E

N 13-52-0E 8.15

Party chick T. Brown
Head Chain R. CRONE
Rear Chain T. Timberlane

0.50' Persimmon, nail is on

Ø EAST side + 1.30' up

SOUTH 12.0

All trees have a Blaze
with a aluminum nail in
middle. All trees have a
witness sign.

S 34-52-0E 9.10

1.0' Ø maple, nail is on
NORTH side + 1.50 up

0.80' Ø SASSAFRAS, nail is on
EAST side + 1.20 up

18-U

18-U

HARRISON

XJNQ

19-A

COPNER 19-A

卷之三

15

TOWNSHIP

PANGE

4 235M 2NM PRINCIPAL MERIDIAN

PANGE

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
N.W. CORN. N.E. $\frac{1}{4}$ SEC. 2	STONE OUT OF GROUND.	MARKED WITH A 3/4" bar and metal post and sign in top	58.85	N 87-44-OE	1-31-92	T.B.	#4 Pg 31	SIGN PLACED

19-A

NW COR. NE 1/4
SECT 2 T 5 S, R 4 E

19-A

19-A

DIETZ FEB 6. 1963

Party Chief T. Brown
 Head Chair B. Moses
 Rear Chair R. Crane
 Power Pole, nail on
 NW Side 0.9 up. C
 $N 32^{\circ} 25' - 0 W = 37.34$

STONE IS .50 X 1.0' OUT OF
 ground. STONE IS marked
 with a 3/4" bar + a metal post +
 sign X in Top.
 1.3 Ø 854, nail on
 $N 87^{\circ} 44' - 0 E = 58.85$

S 41-25-0 W = 15.60
 STONE

Both Trees + Power
 Side + 1.20' up.
 Both Trees bare
 a Blaze with a allumation
 nail in middle. Power
 pole has a allumion reference nail

DATE 1-31-92

HARRISON

五

PRINCIPAL MERIDIAN

RANGE 4 E EAST 2 ND

TOWNSHIP 5 S

COPPER Q-19

19-Q

COLD
MILD
P. CLOUDY
25° 45° F



5/11

VHM	3/15
KBA	
+ GRP 100' N	1072
See Russell /	
RUS 99-1, C.R.D.	

Q-19

3/21/05 Km: HCR 4NE: 55°
1/4 ch. down to 23-24 TSS R4E

EXISTING LIMESTONE W/ DRY CAKES
SOLVED IN GROUTED OR REINFORCED NIS

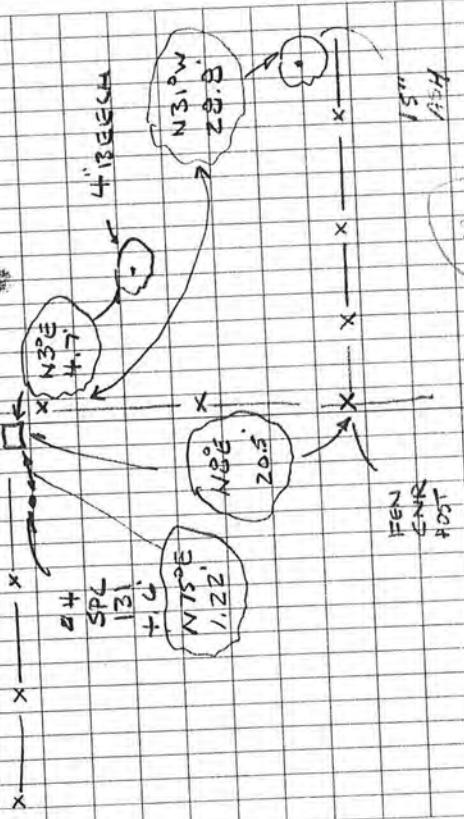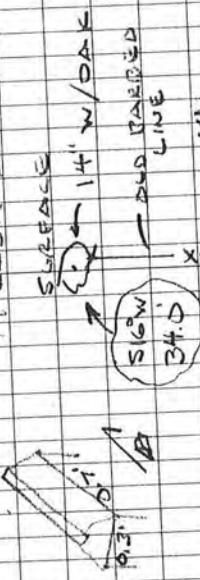

JONES
Sec 25 & 26, T-5-S, R-4-E

4-5 25' 26

JONES-1F. FLD 31

INSTREC 2 TN 22 = 22

BSC 2 TN 22 = 131

JONES-1G. FLD 221 - 226

INSTREC TN = 222

BSC EXSTN = 221

225 = TN - GPS5

228 = TN - GPS4

19-Q

5/71

HARRISON COUNTY SURVEYOR
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP: 5S RANGE: 4E SECTION: _____

CORNER REF. ID: Q-19
DATE: _____

MONUMENT INFORMATION

LOCATION: 1/4 CORNER SEC 23 & 26



DESCRIPTION: STONE

ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: () YES DATE: _____

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. 14" W Oak	()	34.0'	S 16° W
2. 4" Beech	()	47°	N 3° E
3. 15" Ash	()	39.8'	N 31° W

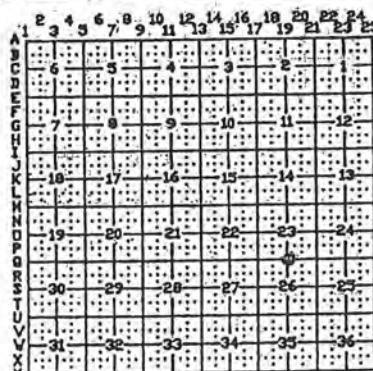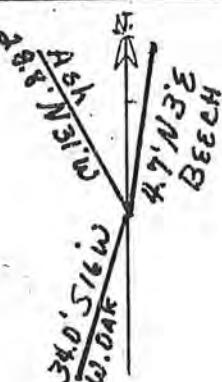

RECOVERED BY: VM

DATE: 3 / 05

DATE: _____

DATE: _____

REFERENCED BY: TOB
203

DATE: 3 / 06

DATE: _____

DATE: _____

RECORDED IN PERPETUATION RECORDS BOOK:
BY: _____

DATE: 3 / 06

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____

Harrison Co. No. Y-19

19-Y

T 5 S R 4E 2nd Mer. County Harrison State Indiana

South Quarter Corner common to section 35

EXISTING SURVEYS

Original Government Survey	Original Evidence Found																		
Year surveyed N/A Original monument <small>(wood post, stone, pile of stones, etc.)</small>	Year of search N/A By _____ Monument found _____																		
Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____	Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____																		
Subsequent Corner Restoration Year surveyed N/A By _____ Where filed or recorded _____ Monument <small>(Original, concrete post, iron rod, etc..)</small>	Evidence of Subsequent Corner Restoration Found Year of search 1980-2011 By VHM Recovered 0.3' by 0.3' concrete monument projecting 1.2'. See Survey 1, Oversize documents #02849 (Herb Fredricks) & Survey Book 5, Page 424 in the Harrison County recorder's office.																		
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____																			
35	Relation of Evidence to Record Features Along Section Lines Section line to sections _____ Object _____ Record Distance _____ Measured Distance _____																		
At time of search: 1. Did you have the record description? Yes <input checked="" type="checkbox"/> No _____ 2. How was search area located? pacing, chaining, photo, maps, etc. SURVEYING 3. Man hours spent in search N/A 4. Do you think additional search might recover evidence? Yes _____ No <input checked="" type="checkbox"/> 5. Signature <u>Vick H. May</u>	Other Evidence Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any The monument is in a hardwoods 40'± North of Mosquito Creek and 100'± South of Mosquito Creek Road. Perpetuation Record Monument and accessories established. Include brief description of area. The monument was left in place as recovered with "T" post 0.5' South-Southeast and 3" cedar post 1.8' South <table border="1"> <thead> <tr> <th>Poplar</th> <th>Sycamore</th> <th>Poplar</th> </tr> </thead> <tbody> <tr> <td>11"</td> <td>12"</td> <td>24"</td> </tr> <tr> <td>N 49° W</td> <td>N 36° E</td> <td>S 83° W</td> </tr> <tr> <td>1.54'</td> <td>28.32'</td> <td>28.45</td> </tr> <tr> <td>Mag Nail + 1.0'</td> <td>Mag Nail + 2.0'</td> <td>Mag Nail + 0.5'</td> </tr> <tr> <td>On NE side W/Sign</td> <td>On S. side</td> <td>In South crown</td> </tr> </tbody> </table> Certified corner restoration certificate prepared Yes _____ No <input checked="" type="checkbox"/> Filed in county records at _____ Date _____ County No. _____ Identified on aerial photo No. _____ Which is filed at _____ ISPCS East Zone 1983 Datum (2011) USSF N: 1011238.4 E: 220739.0	Poplar	Sycamore	Poplar	11"	12"	24"	N 49° W	N 36° E	S 83° W	1.54'	28.32'	28.45	Mag Nail + 1.0'	Mag Nail + 2.0'	Mag Nail + 0.5'	On NE side W/Sign	On S. side	In South crown
Poplar	Sycamore	Poplar																	
11"	12"	24"																	
N 49° W	N 36° E	S 83° W																	
1.54'	28.32'	28.45																	
Mag Nail + 1.0'	Mag Nail + 2.0'	Mag Nail + 0.5'																	
On NE side W/Sign	On S. side	In South crown																	

20-S

20-S

HARRISON

FY

CORNER S - 20 TOWNSHIP 5 - 5RANGE 4 E EAST 2ND PRINCIPAL MERIDIAN

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
Center East $\frac{1}{16}$ Sec. 26	#5 Rear Bar	Sugar Maple	5.8'	N 45° E			TOB ADB	5/18

30-5

JONES - CO, T, D S-20

5/18 C E¹/16 S 26
5S 4E

36" Polar

3 MAPLE

□ O ← NO. 5 SPC 336 "

47762

SUGAR MFG.	T-Post	SUGAR MAP.	SWELL MAP	P-PLATE	"	"
------------	--------	---------------	--------------	---------	---	---

N45E	W	S 61° E		26.4
52°	0.5'	17.8'	10.0	

卷之三

AT SW END OF SUNK HOLE. SURROUNDED BY

14' SOUTH

Woods 200 = SE or SW

FENCELINE OLD E-W

卷之三

A HISTORY OF THE AMERICAN PEOPLE

1

20-T

CITY

HARRISON

CORNER T-20

TOWNSHIP 5 S

RANGE 4 E

2ND PRINCIPAL MERIDIAN

EAST

2ND

PRINCIPAL MERIDIAN

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER?	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
SE 1/16 Section 26	#5 Rebar	Sugar Maple	24.1'	N 42 E	2006	TOB GDB	5/77	Sign
T- Post			0.4'	North				
		Walnut	24.5'	S 84 E				
		Sugar Maple	17.5'	N 63 W				
	Ash		18.5'	S 36 W				

JONES - COUNT'D
T-5-S R4E 595.

5/16

T-2

ON E FACING SLOPE,
50' W OF FORK IN DRAIN
IN WOODS

W OAK
T. Post
No. 5 SPC 336

⑦ 13.5" MAPLE

SUGAR MAPLE T-Post W. OAK
 $6\frac{1}{2}$ " 13.5' 13.5' N 42E
24.1' 0.4'

N 26E N 26E
16.8' 10.6' 0.3' 29.5' 34.6'
W BT SIGN

45°

20-T

5/17

3-24-05

MKF FFB

IN WOODS ON LEFT
BAIL SMALL DRAW N 5' N
OF E 200 ± E OF STAND

OF CEDARS ③ SUG. MAP
DRAW T POST

① NO. 5 SPC 336

② WALNUT

③ ASH

SUGAR MAPLE T-POST
15" 15" 12"
15° N 84E 536W N 63W
24.5' 0.4' 18.5' 17.5'

SUGAR

MAPLE

T-POST

W. OAK

"

"

"

"

"

"

"

"

"

"

20-T

HARRISON COUNTY SURVEYOR 5/77
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHIP: 55 RANGE: 4 E. SECTION: 26

CORNER REF. LD.: T-2D
DATE: 3 / 05

MONUMENT INFORMATION

LOCATION: SE 1/4 SEC 26



DESCRIPTION: #4 S Rebar

ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: () YES DATE: ____ / ____ / ____

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. S. MAP/8	(X)	24.1'	N 42° E
2. T-Post	()	0.4'	N
3. Walnut	()	24.5'	S 84° E

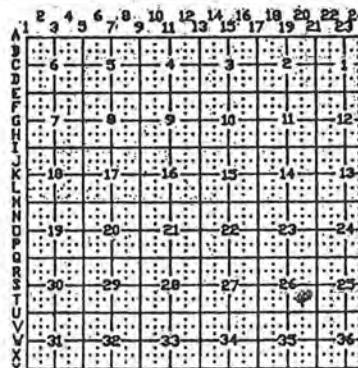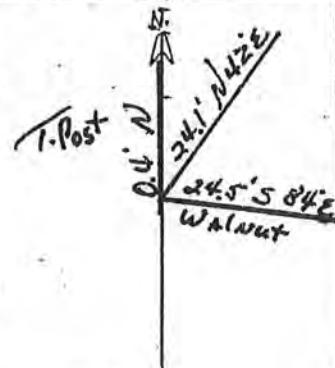

RECOVERED BY: CM DATE: 3 / 05
DATE: _____
DATE: _____

REFERENCED BY: TDB DATE: 1 / 06
DATE: _____
DATE: _____

RECORDED IN PERPETUATION RECORDS BOOK:
BY: _____ DATE: _____ / _____ / _____

21-A

HARRISON

COUNTY

CORNER 21-A

TOWNSHIP 5

RANGE 4

PRINCIPAL MERIDIAN

21- $\frac{1}{4}$ - 4-4-36

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	FIELD BOOK	REMARKS
NE Corner $NE\frac{1}{4}$ Sec 2	$\frac{1}{2}$ ' rebar w/ PEP Cap	4" Maple w/ Sign	8'	N 0-E105	1-12-06	TOB	5/91 Carsonite Post Placed

Same as 21-A
4-4-36

21-A

5/91

HARRISON COUNTY SURVEYOR
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHIP: 5 RANGE: 4 SECTION: 1

CORNER REF. ID: 21A
DATE: 1/12/06

MONUMENT INFORMATION



LOCATION: SW CORNER SW $\frac{1}{4}$ SEC 36 + NE $\frac{1}{4}$ of NE $\frac{1}{4}$ SEC 2
DESCRIPTION: 1/2" REBAR w/ PEP CAP 5-4-2

ADDITIONAL DISTINGUISHING CHARACTERISTICS:

SIGN PLACED: () YES DATE: / /

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. 4" Maple	(X)	()	8' NNE 105°
2.	()	()	
3.	()	()	

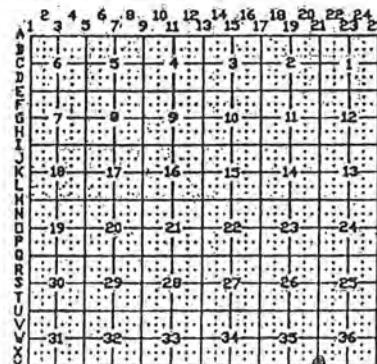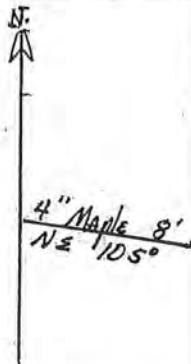

RECOVERED BY: _____

DATE: / /

DATE: / /

DATE: / /

REFERENCED BY: TDB

DATE: 1/12/06

DATE: / /

DATE: / /

RECORDED IN PERPETUATION RECORDS BOOK:

BY: TDB

DATE: 1/12/08

LAND CORNER RECORD
(RECTANGULAR SURVEYS)


Harrison County Surveyor's Reference Index Number: E-21

21-E

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 1, 2, 11 and 12

EXISTING SURVEYS

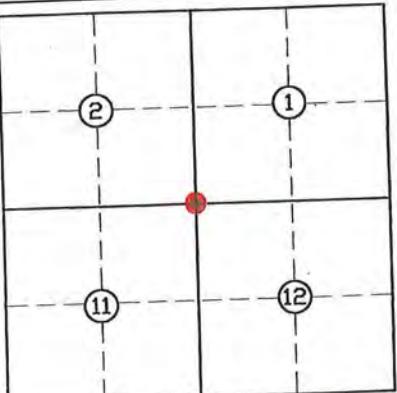Picture/Sketch	Picture/Sketch
	
No Original Government Survey Evidence Recovered	Evidence of Subsequent Corner Restoration Found
N/A	Year of search <u>2017</u> By <u>VHM</u> <u>Recovered mag nail in Plumping Station Road at</u> <u>cultural line West.</u>
	<p>Perpetuation Record</p> <p>Monument and accessories established. Include brief description of area. <u>Replaced mag nail with #5 X 0.8' rebar with mag hub set in concrete plug over monument. The corner position is supported by very old and prominent cultural features in the vicinity and by measurements to adjacent corners. Corner accessories established :</u></p> <p><u>Utility Pole, N 19° E, 75.53', MN + 1.0' on Southwest side.</u></p> <p><u>Telephone Pedestal, N 42° E, 22.17'.</u></p> <p><u>Fence "T" Post, North/South & West, 14.60', with Harrison County Surveyor's sign.</u></p> <p>N: 1037846.71 E: 222965.64</p> <p>Signature <u>VHM</u> Date: <u>07/28/2017</u></p> <p><u>Harold D Kinstler Surveyor 8/8/17</u></p>

HARRISON

COUNTY

21-K

CORNER 21-K

TOWNSHIP 5

RANGE 4

2ND

EAST

PRINCIPAL MERIDIAN

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
SE. CORNER NE $\frac{1}{4}$, SEC. 23		STONE IS 60X60 OUT OF GROUND						STONE IS REFERENCED TO HEAD STONES @ REHOBETH CHURCH
	BROWN, LAWENCER MARGIA G.		3.55	N2-57-OE	9-17-93	T.B.	#4 PG42	
	LUTHER IVAN O FREDIA KINTER		9.36	S78-05-OW				
	CONRAD MARSHALL E RUBY M.		9.33	N78-16-OW				

LAND CORNER RECORD
(RECTANGULAR SURVEYS)


Harrison County Surveyor's Reference Index Number: M-21

21-M

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 13, 14, 23 and 24

EXISTING SURVEYS

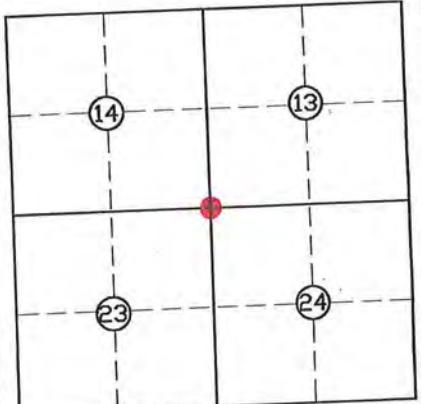Picture/Sketch	Picture/Sketch
	
No Original Government Survey Evidence Recovered See survey recorded in Survey Book 1, Page 589 and Instrument Number 201003246.	Evidence of Subsequent Corner Restoration Found Year of search <u>2017</u> By <u>VHM</u> Recovered railroad spike, 0.3' deep, near centerline/centerline of Rehobeth Road and Old Goshen Road.
	<p>Perpetuation Record Monument and accessories established. Include brief description of area. Set a mag hub in concrete plug over monument. Corner accessories established: Stop Sign, S 68° W, 38.60', with Harrison County Surveyor's sign. Telephone Pedestal, N 52° W, 45.15'. Utility Pole, East, 27.25' to bottom nail of Harrison County Surveyor's sign.</p> <p>N: 1027178.86 E: 223086.86</p> <p>Signature <u>Wink H. R.</u> Date: <u>07/28/2017</u></p> <p><u>Harold L K. Reinert Surveyor B-8-17</u></p>

HABRISSON

11

5

COTNER Q-21

TOWNSHIP 5 S

FIRING LINE

EAST 4 E 2ND

PRINCIPAL MERIDIAN

MONUMENT LOCATION	DESCRIPTION OF REFERENCE POINT	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
Common Corn. 23-24-25-26	# 4 Rebar	43.3'	N 59 W	2006	TOB GDB	5/73	
	Tele. Ped.						
	Wood Gate Post	45.0'	S 6 W				
	Wood Gate Post	46.3'	S 11 E				
	B. Gum	46.4'	N 57 E				

21-Q

HARRISON COUNTY SURVEYOR
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP. 55 RANGE 4 E SECTION: _____

CORNER REF. ID.: Q-21

DATE: 3 / 05

MONUMENT INFORMATION

LOCATION: COMMON CORNER 23-24-26-25


DESCRIPTION: #4 REBAR
.5" BELOW SURFACE OF RD. S.

ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: YES DATE: / /

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. Telephone Post w/Wood Post	()	() 45°3' N 59° W	
2. Wood Gate Post	()	() 45°0' 56° W	
3. Wood Gate Post	()	() 46°3' S 11° E	

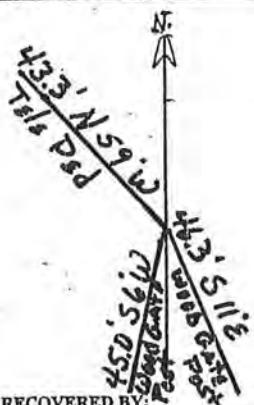

RECOVERED BY: UM

A	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24
B																								
C																								
D																								
E																								
F																								
G																								
H																								
I																								
J																								
K																								
L																								
M																								
N																								
O																								
P																								
Q																								
R																								
S																								
T																								
U																								
V																								
W																								
X																								
Y																								
Z																								

DATE: 3 / 05

DATE: _____

DATE: _____

REFERENCED BY: TOP
GDB

DATE: 1 / 06


DATE: _____

DATE: _____

RECORDED IN PERPETUATION RECORDS BOOK:

BY: _____

5/14

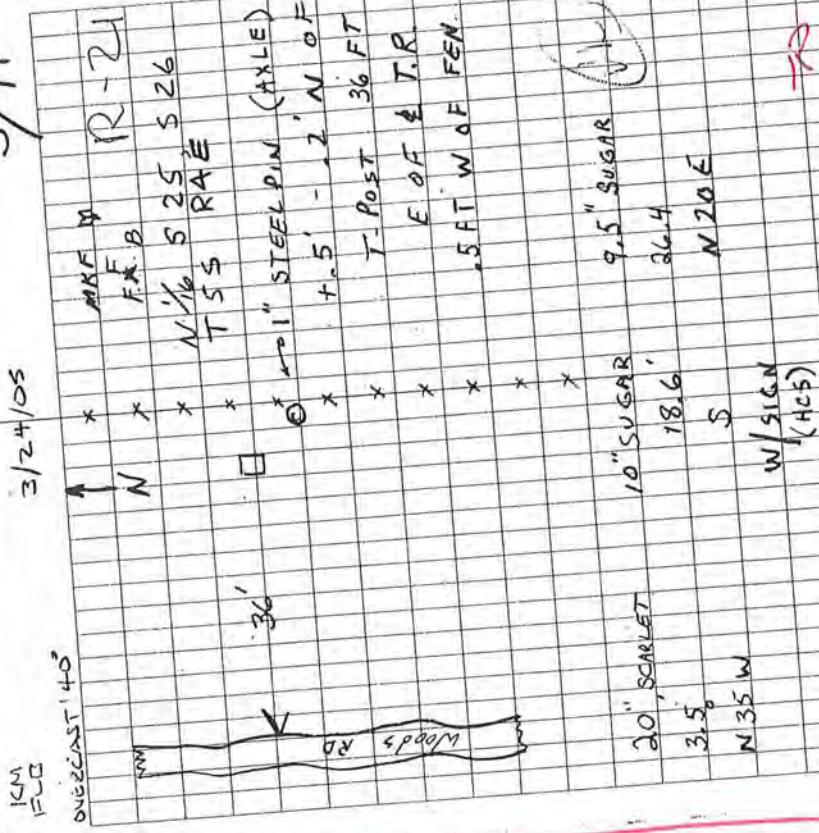

5/13

Q-21

JONES
CONT'D

SEC CUR COMMON TO SEC'S 25, 26, 5'

EXISTING #4 IN ASPHALT RECESS E.
REINFORCED ROAD SURFACE IN ASPHALT E- E.

1

2

3

4

5

6

7

8

9

10

11

12

13

14

15

16

17

18

19

20

21

22

23

24

25

26

27

28

29

30

31

32

33

34


35

36

37

38

39

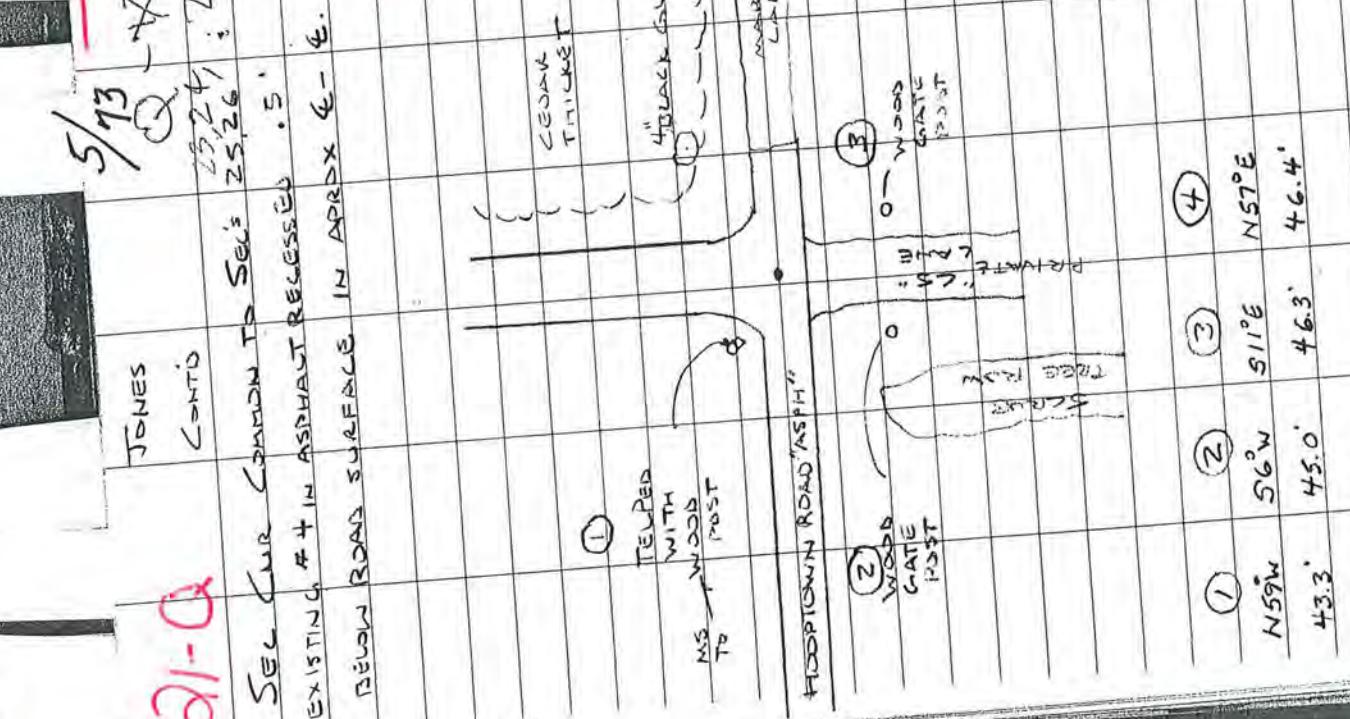

21-R

HARRISON

TY

CORNER R-21

TOWNSHIP 5 S

RANGE 4 E
2ND EAST

PRINCIPAL MERIDIAN

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	FIELD BOOK CHECKED BY	REMARKS
N 1/16 Corn. Sec. 25-26	1" Steel Pin	20" Scarlet	3.5'	N 35 W	2006	TOB GDB	5/74
		10" Sugar	18.6'	South			HCS Sign
		9.5" Sugar	26.4'		N 20 E		

21-R

HARRISON COUNTY SURVEYOR *5/74*
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP. 5 S RANGE: 4 E SECTION: _____ CORNER REF. ID: R-21
DATE: 3 / 05

MONUMENT INFORMATION

LOCATION: N 1/16 CORNER SEC 25 & 26


DESCRIPTION: 1" STEEL PIN
.5' W OF FENCE

ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: () YES DATE: _____

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. 20" SCARLET	()	()	3.5° N 35° W
2. 10" SUGAR	(X)	()	18.6° S
3. 4.5" SUGAR	()	()	26.4° N 20° E

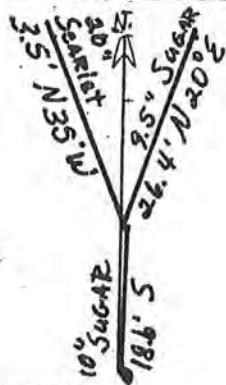

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24
A
B
C
D
E
F
G
H
I
J
K
L
M
N
O
P
Q
R
S
T
U
V
W
X
Y
Z

RECOVERED BY: JM

DATE: 3 / 05

DATE: _____

DATE: _____

REFERENCED BY: T03
GBC

DATE: 06

DATE: _____

DATE: _____

RECORDED IN PERPETUATION RECORDS BOOK:
BY: _____

DATE: _____

HARRISON

TRY

21-S

COPNER S-21

TOWNSHIP 5 S

PRINCIPAL MERIDIAN

RANGE 4 E

2ND

EAST

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
$\frac{1}{4}$ Corner Sec. 25-26	Stone	12" Cedar	14.6'	S 20 E	2006	TOB GDB	5/75	HCS Sign
		Car. Post	.8'	S 60 E				
		19" Oak	20.5'	S 61 E				
		Hickory	9.1'	N 56 W				
		Sugar	4.2'	N 27 E				

21-S

5°

S-21 5/15

JONES - CONT'D

1/4 COR - S 25, S 26

T-S-S
R-4-E
TRACK

IN Woods, ON SLIGHT
N SLOPE

MKF

FFB

324.05

324.05

Black SUGAR

LIMESTONE, G.X.G.X.

N/P

CHINE OAK

ROAD

CEDAR

CARSONITE POST, CHINE OAK

SHAG HICK SUGAR

5." 4"

12' 0" YELLOW 19"

N 27° E

S 60° E S 61° E

9.1' 4.2'

14.6' .8' 20.5'

w/ SIGN
(HCS)

STONE IS ON W. FACING SLOPE, IN TIMBER, APPROX

HALFWAY BETWEEN TOP OF RIDGE AND

CREEK

15

5°

21-S

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County No. Y-21

T 5 S R 4 E 2nd Mer., County Harrison State Indiana

Section Corner common to Sections 35 and 36 (also Sections 1 & 2, T-6-S, R-4-E)

EXISTING SURVEYS

EXISTING SURVEYS	
No Original Government Survey Evidence Recovered	Picture/Sketch
See surveys recorded in Survey Book 1 (oversize file) Document #02849 and Instrument Number 201101613.	N/A
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc...)	Year of search 2014 By VHM
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	Perpetuation Record Monument and accessories established. Include brief description of area. Set a #5 x 30" rebar with 3 1/4" aluminum disk, stamped to depict the corner position. Monument was set in a very old fence post hole. Very old woven wire to the East and tree line to North. Down East-West barbed wire 6 feet South. Set a carsonite post 0.5' South. Corner accessories established. Hackberry, 1", N 28° W, 4.83', with Harrison County Surveyor's sign. Sycamore, 24" w/wire, S 83° W, 34.90' to mag nail 0.5' up in South side. Forked Sugar, 28", N 64° E, 54.57' to mag nail 0.5' up in North side.
	N: 1011198.25 E: 223410.07 N: 1013472.55 { USGS-W26 E: 226031.39 { <p style="text-align: right;">David H. M. 10/08/2014</p>
Signature <u>Virtis H. M.</u>	
Date: <u>10/08/2014</u>	

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____



Harrison Co. No. Y-21

21-Y

T 5 S R 4 E 2nd Mer. County Harrison State Indiana

South Section Corner common to sections 35 & 36

EXISTING SURVEYS

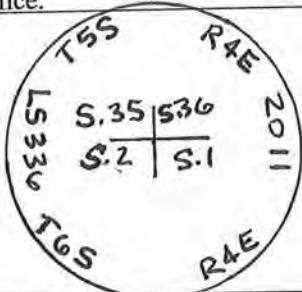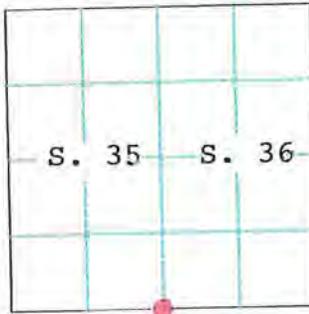Original Government Survey		Original Evidence Found																												
Year surveyed N/A Original monument _____ <small>(wood post, stone, pile of stones, etc.)</small>		Year of search N/A By _____ Monument found _____																												
Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____		Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____																												
Subsequent Corner Restoration Year surveyed N/A By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc.)</small>		Evidence of Subsequent Corner Restoration Found Year of search 1985+ By VHM Used Sycamore Bearing Tree in 1989 survey for verification purposes. See Survey Book 1, Oversize file Document #02849 (Herb Fredricks) in Harrison County Recorder's office.																												
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____																														
		<p>Other Evidence Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any Recovered very old and down woven wire fence and old fence corner post hole. Old tree line & cultivation mound runs North from corner. The position of this corner is supported by very old and distinct cultural features in the vicinity.</p>																												
<p>At time of search:</p> <ol style="list-style-type: none"> 1. Did you have the record description? Yes <input checked="" type="checkbox"/> No _____ 2. How was search area located? pacing, chaining, photo, maps, etc. <u>SURVEYING</u> 3. Man hours spent in search <u>countless</u> 4. Do you think additional search might recover evidence? Yes _____ No <input checked="" type="checkbox"/> 5. Signature <u>Vict H. M.</u> 		<p>Perpetuation Record Monument and accessories established. Include brief description of area. Set #5 by 30" with 3 1/4" aluminum disk, stamped to depict the corner's position.</p> <table border="1"> <thead> <tr> <th>Hackberry</th> <th>Sycamore</th> <th>Forked Sugar</th> <th>Carsonite</th> </tr> </thead> <tbody> <tr> <td>11"</td> <td>24"</td> <td>28"</td> <td>Post</td> </tr> <tr> <td>N 28° W</td> <td>S 83° W</td> <td>N 64° E</td> <td>South</td> </tr> <tr> <td>4.83'</td> <td>34.90'</td> <td>54.47'</td> <td>0.5'</td> </tr> <tr> <td>Mag Nail + 0.5'</td> <td>Mag Nail + 0.5'</td> <td>Mag Nail + 0.5'</td> <td></td> </tr> <tr> <td>On W. side</td> <td>On S. side</td> <td>On N. side</td> <td></td> </tr> <tr> <td>W/Sign</td> <td>W/Wire</td> <td></td> <td></td> </tr> </tbody> </table> <p>Certified corner restoration certificate prepared Yes _____ No <input checked="" type="checkbox"/> Filed in county records at _____ Date _____ County No. _____ Identified on aerial photo No. _____ Which is filed at _____</p> <p align="center">ISPCS East Zone 1983 Datum (2011) USSF N: 1011198.2 E: 223410.1</p>	Hackberry	Sycamore	Forked Sugar	Carsonite	11"	24"	28"	Post	N 28° W	S 83° W	N 64° E	South	4.83'	34.90'	54.47'	0.5'	Mag Nail + 0.5'	Mag Nail + 0.5'	Mag Nail + 0.5'		On W. side	On S. side	On N. side		W/Sign	W/Wire		
Hackberry	Sycamore	Forked Sugar	Carsonite																											
11"	24"	28"	Post																											
N 28° W	S 83° W	N 64° E	South																											
4.83'	34.90'	54.47'	0.5'																											
Mag Nail + 0.5'	Mag Nail + 0.5'	Mag Nail + 0.5'																												
On W. side	On S. side	On N. side																												
W/Sign	W/Wire																													

22-T

HARRISON

CITY

CORNER T-22

TOWNSHIP 5 S

RANGE 4 E

2ND

PRINCIPAL MERIDIAN

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
SW 1/16 Sec. 25	#5 Rebar	6 $\frac{1}{2}$ Sugar	16.8'	N 8 W	2006		TOB GDB	Sign
		S. Maple	10.6'	S 20 E				
		T-Post	0.3'					
		Black Oak	29.5'					N 76 E
		White Oak	34.6'					N 26 E

qq-T 5/16

JONES - CONT'D
T-5-S R4E 525.

T-22

ON E FACING SLOPE,
50' W OF FORK IN DRAIN
IN Woods

E3 MAPLE w/SIGN
W OAK

T-Post
□

⊕ NO. 5 SPC 336 E3 B.SPC

⑦ 13.5" MAPLE

SUGAR MAPLE T-Post BLK OAK W. OAK
6 1/2 " 13.5' 13.5' 11 "

N 76E N 26E
N 08W S 20E
16.8' 10.6' 0.3' 29.5' 34.6' w/B/T SIGN

45°

0,

3-24-05

MKF FFB

5/11

↑

IN WOODS ON LEFT
BAKE SMALL DRAIN, 5' N

OF E 200 ± E OF STAND
OF CEDARS

③ SUG.MAP
DRAIN

② WALNUT

① ASH

SUGAR MAPLE T-Post WALNUT ASH SUGAR MAPLE
15" 12" 17"
S 84E S 36W N 63W
N 42E N 04' 24.5'
24.1' 0.4' 18.5'
w/B/T w/SIGN

45°

0,

3-24-05

MKF FFB

5/20

↑

IN WOODS ON LEFT
BAKE SMALL DRAIN, 5' N

OF E 200 ± E OF STAND
OF CEDARS

③ SUG.MAP
DRAIN

② WALNUT

① ASH

SUGAR MAPLE T-Post WALNUT ASH SUGAR MAPLE
15" 12" 17"
S 84E S 36W N 63W
N 42E N 04' 24.5'
24.1' 0.4' 18.5'
w/B/T w/SIGN

22-T

5/16

HARRISON COUNTY SURVEYOR
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP: 55 RANGE: 4E SECTION: 1

CORNER REF. LD.: T-22
DATE: 3 / 05

MONUMENT INFORMATION

LOCATION: SW 1/4 SEC 25


DESCRIPTION: #5 REBAR

ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: () YES DATE: _____

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. SUGAR	(X)	16. 8° N 8° W	
2. S. Maple	()	10. 6° S 30° E	
3. B OAK	()	39. 5° N 76° E	

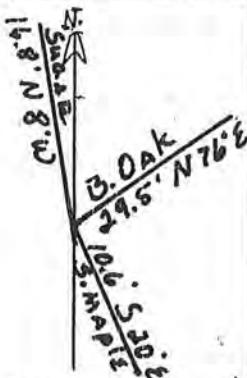

1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24
A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R	S	T	U	V	W	X
2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25
3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26
4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27
5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28
6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29
7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30
8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31
9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32
10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33
11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34
12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35
13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36
14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37
15	16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38
16	17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39
17	18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40
18	19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41
19	20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42
20	21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43
21	22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44
22	23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45
23	24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46
24	25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47
25	26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48
26	27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49
27	28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50
28	29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51
29	30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52
30	31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53
31	32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54
32	33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55
33	34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56
34	35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57
35	36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58
36	37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59
37	38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60
38	39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61
39	40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62
40	41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63
41	42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64
42	43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65
43	44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66
44	45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67
45	46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68
46	47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69
47	48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70
48	49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71
49	50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72
50	51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73
51	52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74
52	53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75
53	54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76
54	55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77
55	56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76	77	78
56	57	58	59	60	61	62	63	64	65	66	67	68	69	70	71	72	73	74	75	76			

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____




Harrison Co. No. Y-22

T 5 S R 4 E 2nd Mer. County Harrison State Indiana

West Sixteenth in South Line Section 36

22-1

EXISTING SURVEYS

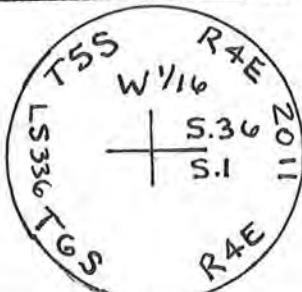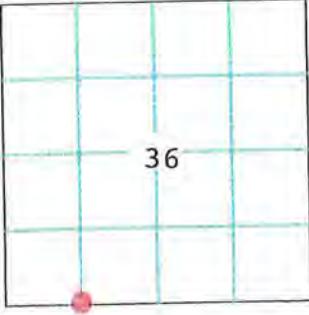Original Government Survey	Original Evidence Found																												
Year surveyed N/A Original monument <small>(wood post, stone, pile of stones, etc.)</small>	Year of search N/A By _____ Monument found _____																												
Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____	Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____																												
Subsequent Corner Restoration Year surveyed N/A By _____ Where filed or recorded _____ Monument <small>(Original, concrete post, iron rod, etc..)</small>	Evidence of Subsequent Corner Restoration Found Year of search 2011 By VHM Recovered old down fence South from corner. Established corner position per 2002 Survey by Primavera and Associates, see Survey Book 5, Pages 406 & 407 of the Harrison County Recorder's office.																												
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____																													
	Other Evidence Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any _____																												
At time of search: 1. Did you have the record description? Yes <input checked="" type="checkbox"/> No _____ 2. How was search area located? pacing, chaining, photo, maps, etc. SURVEYING 3. Man hours spent in search 4 4. Do you think additional search might recover evidence? Yes _____ No <input checked="" type="checkbox"/> 5. Signature 	Perpetuation Record Monument and accessories established. Include brief description of area. Set #5 by 30" with 3 1/4" aluminum disk, stamped to depict the corner's position. <table border="1"> <thead> <tr> <th>Beech</th> <th>Sugar</th> <th>Sugar</th> <th>Carsonite</th> </tr> </thead> <tbody> <tr> <td>5"</td> <td>18"</td> <td>11"</td> <td>Post</td> </tr> <tr> <td>N 84° W</td> <td>S 51° E</td> <td>S 48° W</td> <td>South</td> </tr> <tr> <td>7.44'</td> <td>36.74'</td> <td>20.37'</td> <td>0.5'</td> </tr> <tr> <td>Mag Nail + 0.5'</td> <td>Mag Nail + 0.5'</td> <td>Mag Nail + 0.5'</td> <td></td> </tr> <tr> <td>On S. side</td> <td>On S. side</td> <td>On E. side</td> <td></td> </tr> <tr> <td>W/Sign</td> <td></td> <td>W/Wire</td> <td></td> </tr> </tbody> </table> Certified corner restoration certificate prepared Yes _____ No <input checked="" type="checkbox"/> Filed in county records at _____ Date _____ County No. _____ Identified on aerial photo No. _____ Which is filed at _____ ISPCS East Zone 1983 Datum (2011) USSF N: 1011160.5 E: 224737.0	Beech	Sugar	Sugar	Carsonite	5"	18"	11"	Post	N 84° W	S 51° E	S 48° W	South	7.44'	36.74'	20.37'	0.5'	Mag Nail + 0.5'	Mag Nail + 0.5'	Mag Nail + 0.5'		On S. side	On S. side	On E. side		W/Sign		W/Wire	
Beech	Sugar	Sugar	Carsonite																										
5"	18"	11"	Post																										
N 84° W	S 51° E	S 48° W	South																										
7.44'	36.74'	20.37'	0.5'																										
Mag Nail + 0.5'	Mag Nail + 0.5'	Mag Nail + 0.5'																											
On S. side	On S. side	On E. side																											
W/Sign		W/Wire																											

COPNER 23 A HARRISON CO. TY
TOWNSHIP 5 RANGE 4 EAST 2ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF MONUMENT	REFERENCE	DISTANCE FROM CORNER	BEARING	FROM CORNER	DATE CHECKED	FIELD BOOK	REMARKS
NW Corner NE $\frac{1}{4}$ Sec. 1	Stone 3x8 1 $\frac{1}{2}$ " out of ground Carsonite Post+Rebar	4" Beech	12' 1"	NO-E88	11-9-05	TOB	5/87	

23-A

HARRISON COUNTY SURVEYOR *3/87*
CORNER MONUMENT RECOVERY & REFERENCE RECORD

5/87

TWNSHP: 5 RANGE: 4 SECTION: 1 CORNER REF. ID.: 23A
DATE: 11 / 08

MONUMENT INFORMATION

LOCATION: NW CORNER NE $\frac{1}{4}$ SEC 1



DESCRIPTION: STONE 3x8 - 14 1/2 "out of ground

ADDITIONAL DISTINGUISHING CHARACTERISTICS:

SIGN PLACED: YES DATE: 11/09/05

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. 4" BEECH	()	()	10° 1" N 0° E 88
2. 6" MAPLE w/ SIGN	(X)	()	9° 9" 30° W 21
3.	()	()	

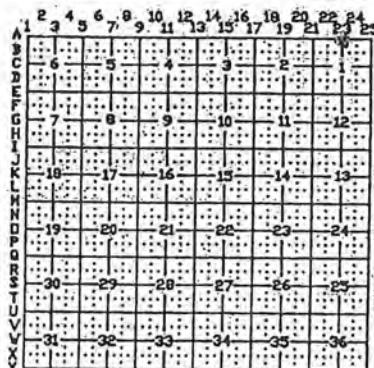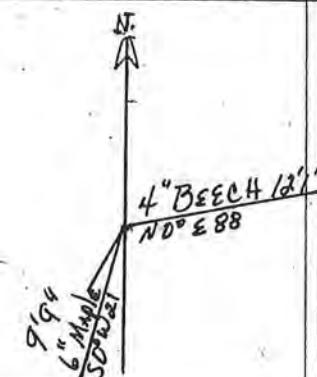

RECOVERED BY: _____ DATE: ____ / ____ / ____

_____ DATE: ____ / ____ / ____

_____ DATE: ____ / ____ / ____

REFERENCED BY: TDB DATE: 11/9/05

RECORDED IN PERPETUATION RECORDS BOOK:
BY: TDB DATE: 1/02/08

23-B

CITY

HARRISON

CORNER 23-B

TOWNSHIP 5

RANGE 4 EAST 2ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF MONUMENT	REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
SW Corner NW $\frac{1}{4}$ -NE $\frac{1}{4}$ Sec 1	Rock 5x2" 1 $\frac{1}{2}$ " above ground	4" Maple	31' 6"	N 42 E	1-11-06	TOB	5/107	Post Placed
	7" Maple		11' 9"	S	"	"		Sign Placed

Q3-B

HARRISON COUNTY SURVEYOR 5/07
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP: 5 RANGE: 4 SECTION: 1 CORNER REF. LD. B-23
DATE: 1/11/06

MONUMENT INFORMATION

LOCATION: SW CORNER - NW 1/4 - NE 1/4 SEC. 1


DESCRIPTION: 5" x 2" Rock 1/2" above ground

ADDITIONAL DISTINGUISHING CHARACTERISTICS:

SIGN PLACED: () YES DATE: / /

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. 4" MAPLE	(X)	()	3 1/6" N 42° E Post
2. 7" MAPLE	(X)	()	1 1/9" S SIGN
3.	()	()	

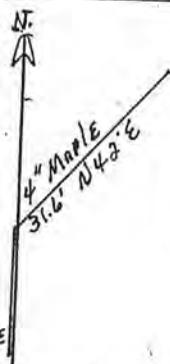

RECOVERED BY: TOB

DATE: 1/11/06

DATE: / /

DATE: / /

REFERENCED BY: TOB

DATE: 1/11/06

DATE: / /

DATE: / /

RECORDED IN PERPETUATION RECORDS BOOK:

TOB

DATE: 1/28/08

23-U

CORNER 23-U

TOWNSHIP 5

RANGE 4 EAST

2ND

PRINCIPAL MERIDIAN

HARRISON COUNTY

N.W. CORNER N.E. 1/4 SECTION 36

23-U

PRINCIPAL MERIDIAN

LOCATION	MONUMENT	DESCRIPTION OF REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
N.W. CORNER N.E. 1/4 SECTION 36	STONE	1.50 BEECH	78.0	WEST SIDE	12-22-93	T.B	#4 Pg58	SIGN PLACED
		0.80 ♂ BEECH	47.21	S 78-32-0W	STONE OUT OF GROUND			SIGN PLACED
		2.40 ♂ BEECH	49.75	S 65-39-0W	:			sign placed

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____


Harrison Co. No. U-23

Q3-U

T 5 S R 4E 2nd Mer. County Harrison State Indiana

Quarter Corner common to sections 25 & 36

EXISTING SURVEYS

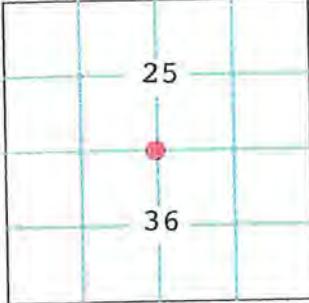Original Government Survey		Original Evidence Found																								
Year surveyed <u>N/A</u> Original monument _____ <small>(wood post, stone, pile of stones, etc.)</small>		Year of search <u>N/A</u> By _____ Monument found _____																								
Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____		Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____																								
Subsequent Corner Restoration Year surveyed <u>N/A</u> By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc...)</small>		Evidence of Subsequent Corner Restoration Found Year of search <u>1980-2011</u> By <u>VHM</u> Recovered base of sandstone per <u>Instrument Numbers 20003188 & 20005338 on file in the Harrison Co.</u> Recorder's Office																								
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____																										
		Relation of Evidence to Record Features Along Section Lines Section line to sections _____ Object _____ Record Distance _____ Measured Distance _____																								
		Other Evidence Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any. <u>Monument is at PI in Sunset Strip on North edge of woods road to the West.</u>																								
		Perpetuation Record Monument and accessories established. Include brief description of area. <u>Stone was recovered out of ground. Set #5 by 30" with 3 1/4" aluminum disk, stamped to depict the corner position. Buried the stone beside the monument.</u>																								
		<table border="1"> <thead> <tr> <th>Beech</th> <th>Poplar</th> <th>Beech</th> <th>Carsonite</th> </tr> </thead> <tbody> <tr> <td>28"</td> <td>10"</td> <td>20"</td> <td>Post</td> </tr> <tr> <td>N 52° W</td> <td>N 54° E</td> <td>S 45° W</td> <td>North</td> </tr> <tr> <td>29.20'</td> <td>39.10'</td> <td>26.18'</td> <td>0.5'</td> </tr> <tr> <td>Mag Nail + 0.5'</td> <td>Mag Nail + 2.0'</td> <td>Mag Nail + 0.5'</td> <td></td> </tr> <tr> <td>In North crown</td> <td>On SE side</td> <td>In SE crown W/Sign</td> <td></td> </tr> </tbody> </table>	Beech	Poplar	Beech	Carsonite	28"	10"	20"	Post	N 52° W	N 54° E	S 45° W	North	29.20'	39.10'	26.18'	0.5'	Mag Nail + 0.5'	Mag Nail + 2.0'	Mag Nail + 0.5'		In North crown	On SE side	In SE crown W/Sign	
Beech	Poplar	Beech	Carsonite																							
28"	10"	20"	Post																							
N 52° W	N 54° E	S 45° W	North																							
29.20'	39.10'	26.18'	0.5'																							
Mag Nail + 0.5'	Mag Nail + 2.0'	Mag Nail + 0.5'																								
In North crown	On SE side	In SE crown W/Sign																								
		Certified corner restoration certificate prepared Yes <u> </u> No <u>X</u> Filed in county records at _____ Date _____ County No. _____ Identified on aerial photo No. _____ Which is filed at _____ ISPCS East Zone 1983 Datum (2011) USSF N: 1016504.8 E: 225932.2																								
At time of search: 1. Did you have the record description? Yes <u>X</u> No _____ 2. How was search area located? pacing, chaining, photo, maps, etc. <u>SURVEYING</u> 3. Man hours spent in search <u>N/A</u> 4. Do you think additional search might recover evidence? Yes _____ No <u>X</u> 5. Signature <u>Vit. H. M.</u>																										

23-U

23-U

DIETZGEN No. 3853

N.W. cor. N.E. 1/4
sec. 36 T 55, R 9 E

Party Chief T. Brown
Head Chain R. Mills
Rear Chain B. Moses

.40 & Beech nail on
with Side + 200' up.

STONE

No. 39-our 49.75

78.0'

No. 32-our 47.21

78.0'

No. 30

78.0'

No. 29

78.0'

No. 28

78.0'

No. 27

78.0'

No. 26

78.0'

No. 25

78.0'

No. 24

78.0'

No. 23

78.0'

No. 22

78.0'

No. 21

78.0'

No. 20

78.0'

No. 19

78.0'

No. 18

78.0'

No. 17

78.0'

No. 16

78.0'

No. 15

78.0'

No. 14

78.0'

No. 13

78.0'

No. 12

78.0'

No. 11

78.0'

No. 10

78.0'

No. 9

78.0'

No. 8

78.0'

No. 7

78.0'

No. 6

78.0'

No. 5

78.0'

No. 4

78.0'

No. 3

78.0'

No. 2

78.0'

No. 1

78.0'

No. 0

78.0'

No. -1

78.0'

No. -2

78.0'

No. -3

78.0'

No. -4

78.0'

No. -5

78.0'

No. -6

78.0'

No. -7

78.0'

No. -8

78.0'

No. -9

78.0'

No. -10

78.0'

No. -11

78.0'

No. -12

78.0'

No. -13

78.0'

No. -14

78.0'

No. -15

78.0'

No. -16

78.0'

No. -17

78.0'

No. -18

78.0'

No. -19

78.0'

No. -20

78.0'

No. -21

78.0'

No. -22

78.0'

No. -23

78.0'

No. -24

78.0'

No. -25

78.0'

No. -26

78.0'

No. -27

78.0'

No. -28

78.0'

No. -29

78.0'

No. -30

78.0'

No. -31

78.0'

No. -32

78.0'

No. -33

78.0'

No. -34

78.0'

No. -35

78.0'

No. -36

78.0'

No. -37

78.0'

No. -38

78.0'

No. -39

78.0'

No. -40

78.0'

No. -41

78.0'

No. -42

78.0'

No. -43

78.0'

No. -44

78.0'

No. -45

78.0'

No. -46

78.0'

No. -47

78.0'

No. -48

78.0'

No. -49

78.0'

No. -50

78.0'

No. -51

78.0'

No. -52

78.0'

No. -53

78.0'

No. -54

78.0'

No. -55

78.0'

No. -56

78.0'

No. -57

78.0'

No. -58

78.0'

No. -59

78.0'

No. -60

78.0'

No. -61

78.0'

No. -62

78.0'

No. -63

78.0'

No. -64

78.0'

No. -65

78.0'

No. -66

78.0'

No. -67

78.0'

No. -68

78.0'

No. -69

78.0'

No. -70

78.0'

No. -71

78.0'

No. -72

78.0'

No. -73

78.0'

No. -74

78.0'

No. -75

78.0'

No. -76

78.0'

No. -77

78.0'

No. -78

78.0'

No. -79

78.0'

No. -80

78.0'

No. -81

78.0'

No. -82

78.0'

No. -83

78.0'

No. -84

78.0'

No. -85

78.0'

No. -86

78.0'

No. -87

78.0'

No. -88

78.0'

No. -89

78.0'

No. -90

78.0'

No. -91

78.0'

No. -92

78.0'

No. -93

78.0'

No. -94

78.0'

No. -95

78.0'

No. -96

78.0'

No. -97

78.0'

No. -98

78.0'

No. -99

78.0'

No. -100

78.0'

1.80 & Beech nail on
orth Side + 2.55 up.
Stone is .50 x .50
x 1.50 & Beech nail on
ground. Stone is west side + 3.0' up.

marked with metal post + sign.

Date 12-22-93

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____


Harrison Co. No. W-23

23-W

T 5 S R 4E 2nd Mer. County Harrison State Indiana

Center Quarter Corner common to section 36

EXISTING SURVEYS

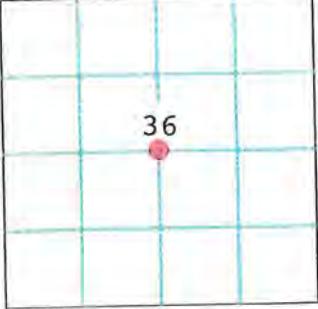Original Government Survey	Original Evidence Found																								
Year surveyed N/A Original monument <small>(wood post, stone, pile of stones, etc.)</small>	Year of search N/A By _____ Monument found _____																								
Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____	Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____																								
Subsequent Corner Restoration Year surveyed N/A By _____ Where filed or recorded _____ Monument <small>(Original, concrete post, iron rod, etc..)</small>	Evidence of Subsequent Corner Restoration Found Year of search 1980-2011 By VHM Recovered railroad spike 0.1' deep in Sunset Strip. See Instrument Numbers 20003188 & 20005338																								
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____																									
	Relation of Evidence to Record Features Along Section Lines Section line to sections _____ Object _____ Record Distance _____ Measured Distance _____																								
At time of search: 1. Did you have the record description? Yes <input checked="" type="checkbox"/> No _____ 2. How was search area located? pacing, chaining, photo, maps, etc. SURVEYING	Other Evidence Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any.																								
3. Man hours spent in search N/A 4. Do you think additional search might recover evidence? Yes _____ No <input checked="" type="checkbox"/>	Perpetuation Record Monument and accessories established. Include brief description of area. Set mag nail in concrete plug over railroad spike. <table border="1"> <tr> <td>Utility Pole</td> <td>30" CMP</td> <td>Box Elder</td> <td>Steel Pin W/cap</td> </tr> <tr> <td>W/USD</td> <td>West End</td> <td>12"</td> <td>L.S. 336</td> </tr> <tr> <td>S 74° E</td> <td>S 14° W</td> <td>S 68° W</td> <td>East</td> </tr> <tr> <td>27.48'</td> <td>55.10'</td> <td>39.14'</td> <td>21.0'</td> </tr> <tr> <td>Mag Nail +0.9'</td> <td>Mag Nail + 0.5'</td> <td></td> <td></td> </tr> <tr> <td>On South side W/Sign</td> <td>On Southeast crown</td> <td></td> <td></td> </tr> </table>	Utility Pole	30" CMP	Box Elder	Steel Pin W/cap	W/USD	West End	12"	L.S. 336	S 74° E	S 14° W	S 68° W	East	27.48'	55.10'	39.14'	21.0'	Mag Nail +0.9'	Mag Nail + 0.5'			On South side W/Sign	On Southeast crown		
Utility Pole	30" CMP	Box Elder	Steel Pin W/cap																						
W/USD	West End	12"	L.S. 336																						
S 74° E	S 14° W	S 68° W	East																						
27.48'	55.10'	39.14'	21.0'																						
Mag Nail +0.9'	Mag Nail + 0.5'																								
On South side W/Sign	On Southeast crown																								
5. Signature <u>Vicki M.</u>	Certified corner restoration certificate prepared Yes _____ No <input checked="" type="checkbox"/> Filed in county records at _____ Date _____ County No. _____ Identified on aerial photo No. _____ Which is filed at _____ ISPCS East Zone 1983 Datum (2011) USSF N: 1013838.8 E: 225998.2																								

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____


Harrison Co. No. Y-23

23-Y

T 5 S R 4E 2nd Mer. County Harrison State Indiana

South Quarter Corner common to section 36

EXISTING SURVEYS

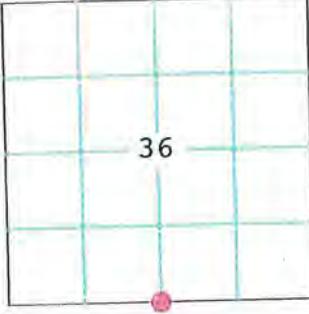Original Government Survey	Original Evidence Found																								
Year surveyed N/A Original monument _____ <small>(wood post, stone, pile of stones, etc.)</small>	Year of search N/A By _____ Monument found _____																								
Bearing Trees																									
Species _____ Diameter _____ Bearing _____ Distance _____	Species _____ Diameter _____ Bearing _____ Distance _____																								
Subsequent Corner Restoration																									
Year surveyed N/A By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc...)</small>	Year of search 2011 By VHM Recovered mag nail over railroad spike in Sunset Strip at "T" drive to the West 11' East of West edge of pavement. See 2002 Surveys recorded in Survey Book 5, Pages 406 & 407 of the Harrison County Recorder's office.																								
Bearing Trees, Reference Objects																									
Species _____ Diameter _____ Bearing _____ Distance _____																									
Relation of Evidence to Record Features Along Section Lines																									
	Section line to sections _____																								
	Object _____																								
	Record Distance _____																								
	Measured Distance _____																								
	Other Evidence																								
Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any _____																									
Perpetuation Record																									
Monument and accessories established. Include brief description of area. Set mag nail in concrete plug over railroad spike.																									
<table border="1"> <thead> <tr> <th>Utility Pole</th> <th>Utility Pole</th> <th>W. Oak</th> <th>#5 Pin</th> </tr> </thead> <tbody> <tr> <td>W/Trans.</td> <td></td> <td>28"</td> <td>0.3' deep</td> </tr> <tr> <td>S 82° E</td> <td>S 55° W</td> <td>N 64° W</td> <td>N 89° W</td> </tr> <tr> <td>24.57'</td> <td>19.65'</td> <td>27.58'</td> <td>21.6'</td> </tr> <tr> <td>Mag Nail + 0.5'</td> <td>Mag Nail + 0.5'</td> <td>Mag Nail + 0.5'</td> <td></td> </tr> <tr> <td>On N. side W/Sign</td> <td>On N. side</td> <td>On S. side</td> <td></td> </tr> </tbody> </table>		Utility Pole	Utility Pole	W. Oak	#5 Pin	W/Trans.		28"	0.3' deep	S 82° E	S 55° W	N 64° W	N 89° W	24.57'	19.65'	27.58'	21.6'	Mag Nail + 0.5'	Mag Nail + 0.5'	Mag Nail + 0.5'		On N. side W/Sign	On N. side	On S. side	
Utility Pole	Utility Pole	W. Oak	#5 Pin																						
W/Trans.		28"	0.3' deep																						
S 82° E	S 55° W	N 64° W	N 89° W																						
24.57'	19.65'	27.58'	21.6'																						
Mag Nail + 0.5'	Mag Nail + 0.5'	Mag Nail + 0.5'																							
On N. side W/Sign	On N. side	On S. side																							
Certified corner restoration certificate prepared Yes _____ No X _____																									
Filed in county records at _____ Date _____ County No. _____																									
Identified on aerial photo No. _____ Which is filed at _____																									
ISPCS East Zone 1983 Datum (2011) USSF																									
N: 1011152.5 E: 226069.5																									
5. Signature <u>Vick H. M.</u>																									

24-B

24-B

CITY

HARRISON

CORNER 24-B TOWNSHIP 5 RANGE 4 EAST 2ND PRINCIPAL MERIDIAN

LOCATION	DESCRIPTION OF MONUMENT	REFERENCE	DISTANCE FROM CORNER	BEARING FROM CORNER	DATE CHECKED	CHECKED BY	FIELD BOOK	REMARKS
Iron P NE Corner SW $\frac{1}{4}$ -NE $\frac{1}{4}$ Sec. 1	Iron Pin	6x6 Pine fence post	22'	N O-E 34	11-10-05	TOB	5/92	Sign Placed

24-B

HARRISON COUNTY SURVEYOR
CORNER MONUMENT RECOVERY & REFERENCE RECORD

5/92

TWNSHP: 5 RANGE: 4 SECTION: 1

CORNER REF. ID: 24-B
DATE: 11/10/05

MONUMENT INFORMATION

LOCATION: NE CORN. SW 1/4 - NE 1/4

DESCRIPTION: IRON PIN

ADDITIONAL DISTINGUISHING CHARACTERISTICS:

SIGN PLACED: YES DATE: 11/10/05

WITNESS MARKERS

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. 6"x6 Pine Fence Post	()	()	22' NE 34°
2. 6" Maple	()	()	30' SW 25°
3.	()	()	



1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24
A	B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R	S	T	U	V	W	X
6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	26	27	28	29
B	C	D	E	F	G	H	I	J	K	L	M	N	O	P	Q	R	S	T	U	V	W	X	Y
1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24

RECOVERED BY:

DATE: / /
DATE: / /
DATE: / /

REFERENCED BY: TDB

DATE: 11/10/05
DATE: / /
DATE: / /

RECORDED IN PERPETUATION RECORDS BOOK:

DATE: 11/10/08

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____

Harrison Co. No. U-24

24-U

T 5 S R 4E 2nd Mer. County Harrison State Indiana

East Sixteenth Corner common to sections 25 & 36

EXISTING SURVEYS

Original Government Survey	Original Evidence Found																		
Year surveyed <u>N/A</u> Original monument _____ <small>(wood post, stone, pile of stones, etc.)</small>	Year of search <u>N/A</u> By _____ Monument found _____																		
Bearing Trees																			
Species _____ Diameter _____ Bearing _____ Distance _____	Species _____ Diameter _____ Bearing _____ Distance _____																		
Subsequent Corner Restoration																			
Year surveyed <u>N/A</u> By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc..)</small>	Evidence of Subsequent Corner Restoration Found <u>Year of search 2011 By VHM</u> <u>Recovered railroad spike 0.1' deep in Sunset Strip at</u> <u>tree line to North. See Instrument Number 20005338</u>																		
Bearing Trees, Reference Objects																			
Species _____ Diameter _____ Bearing _____ Distance _____																			
Relation of Evidence to Record Features Along Section Lines																			
	Section line to sections _____ Object _____ Record Distance _____ Measured Distance _____																		
Other Evidence																			
Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any.																			
Perpetuation Record																			
Monument and accessories established. Include brief description of area. Set mag nail in concrete plug over railroad spike.																			
<table border="0"> <tr> <td style="width: 33.33%;">Elm</td> <td style="width: 33.33%;">12" CMP</td> <td style="width: 33.33%;">Poplar</td> </tr> <tr> <td>8"</td> <td>North End</td> <td>15"</td> </tr> <tr> <td>N 10° W</td> <td>N 54° E</td> <td>N 76° W</td> </tr> <tr> <td>22.75'</td> <td>53.64'</td> <td>79.60'</td> </tr> <tr> <td>Mag Nail + 5.0'</td> <td colspan="2">Mag Nail + 0.6'</td> </tr> <tr> <td>On West side W/Sign</td> <td colspan="2">On South side</td> </tr> </table>		Elm	12" CMP	Poplar	8"	North End	15"	N 10° W	N 54° E	N 76° W	22.75'	53.64'	79.60'	Mag Nail + 5.0'	Mag Nail + 0.6'		On West side W/Sign	On South side	
Elm	12" CMP	Poplar																	
8"	North End	15"																	
N 10° W	N 54° E	N 76° W																	
22.75'	53.64'	79.60'																	
Mag Nail + 5.0'	Mag Nail + 0.6'																		
On West side W/Sign	On South side																		
Certified corner restoration certificate prepared Yes _____ No <u>X</u>																			
Filed in county records at _____ Date _____ County No. _____																			
Identified on aerial photo No. _____ Which is filed at _____																			
ISPCS East Zone 1983 Datum (2011) USSF																			
N: 1016496.4																			
E: 227271.4																			
5. Signature <u>Vick H. M.</u>																			

25-E



HARRISON COUNTY SURVEYOR
CORNER MONUMENT RECOVERY & REFERENCE RECORD

TWNSHP: 5s RANGE: 4E SECTION: 1CORNER REF. I.D.: 25-E
DATE: 3/6/2000**MONUMENT INFORMATION**LOCATION: Southeast Corner of Section #1DESCRIPTION: Limestone 0.8' x 0.25' w 0.5' up

ADDITIONAL DISTINGUISHING CHARACTERISTICS: _____

SIGN PLACED: YES DATE: 8/19/99 *Yellow Gov Survey Marker on Green Metal Post***WITNESS MARKERS**

TYPE	SIGN	BLAZE	ADDITION DESCRIPTION
1. Tree	(✓)	(✓)	Blaze & Nail 12" up
2. Tree	(✓)	(✓)	" " " 12" up
3. Tree	(✓)	(✓)	" " " 12" up

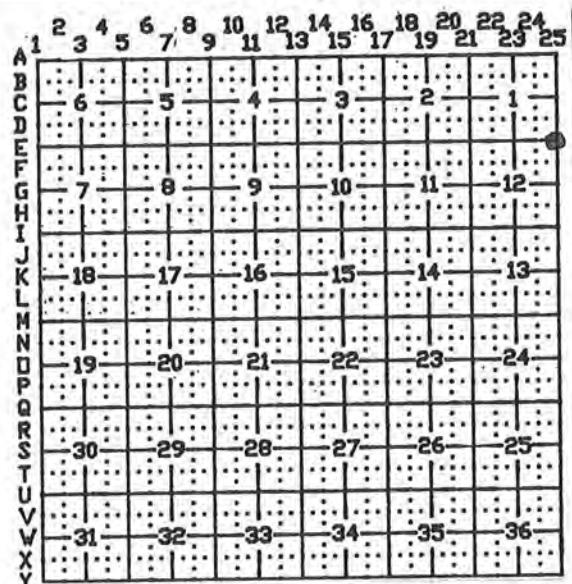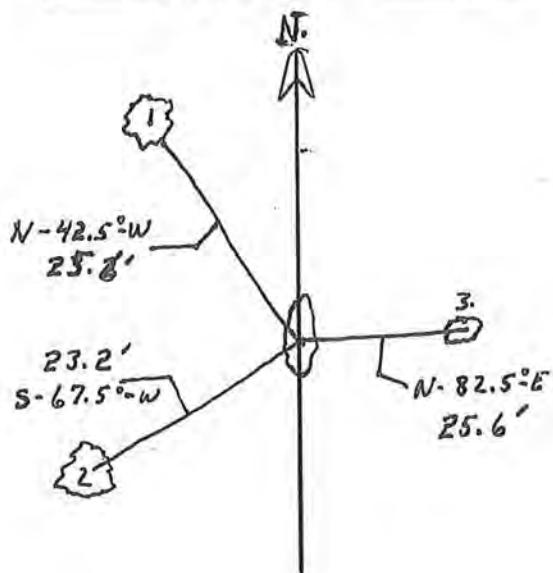RECOVERED BY: J.R. Echant
Brian AlbersDATE: 8/19/99 Common corner to
DATE: 8/19/99 5/4/12 SE corner 25-
DATE: 1/1/00 5/5/06 SW corner 1-REFERENCED BY: J.R. Echant
Brian AlbersDATE: 8/19/99 5/4/12 NE corner 25-
DATE: 8/19/99 5/5/06 NW corner 1-
DATE: 1/1/00 5/5/07 NW corner 1-RECORDED IN PERPETUATION RECORDS BOOK:
BY: H. ReesDATE: 3/18/2000

Q5-I

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Harrison County Surveyor's Reference Index Number: I-1 & I-25

T 5 S R 4 E & R 5 E 2nd Mer., County Harrison State IndianaEast Section Corner common to Sections 12 & 13, T-5-S, R-4-R
andWest Section Corner common to Sections 7 & 18, T-5-S, R-5-E

EXISTING SURVEYS	
No Original Government Survey Evidence Recovered	Picture/Sketch
See survey recorded in Instrument Number 200206583.	
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____ Where filed or recorded _____ Monument _____ (Original, concrete post, iron rod, etc...)	Year of search <u>2015</u> By <u>VHM</u> <u>Recovered railroad spike, 0.3' deep.</u>
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	
	Perpetuation Record Monument and accessories established. Include brief description of area. <u>Set mag nail in concrete plug over railroad spike in centerline-centerline of Indiana State Highway 11 and Harrison County Park</u> <u>Corner accessories established:</u> <u>Pine, 14", N 5° W, 32.07', MN +1.0' on West side.</u> <u>Utility Pole, S 54° E, 71.28', with Harrison County Surveyor's sign,</u> <u>bottom nail.</u> <u>R.O.W. Monument, S 45° W, 70.79'.</u> N: 1032570.5 E: 228344.4
Signature <u>V.H.M.</u> Date: <u>11/02/15</u>	

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____

Harrison Co. No. U-25

25-U

T 5 S R 4 E 2nd Mer. County Harrison State Indiana

East Section Corner common to sections 25 & 36

EXISTING SURVEYS

Original Government Survey	Original Evidence Found																								
Year surveyed N/A Original monument _____ <small>(wood post, stone, pile of stones, etc.)</small>	Year of search N/A By _____ Monument found _____																								
Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____	Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____																								
Subsequent Corner Restoration Year surveyed N/A By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc...)</small>	Evidence of Subsequent Corner Restoration Found Year of search 1980-2011 By VHM Recovered railroad spike 0.35' deep in intersection of Old Dam 43 Road and Sunset Strip. See Primavera & Associates Job No. 93-5882 and 1999 County Perpetuation Project.																								
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____																									
	Relation of Evidence to Record Features Along Section Lines Section line to sections _____ Object _____ Record Distance _____ Measured Distance _____																								
At time of search: 1. Did you have the record description? Yes <input checked="" type="checkbox"/> No _____ 2. How was search area located? pacing, chaining, photo, maps, etc. SURVEYING 3. Man hours spent in search N/A 4. Do you think additional search might recover evidence? Yes _____ No <input checked="" type="checkbox"/> 5. Signature <u>Vin H. M.</u>	Other Evidence Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any _____																								
	Perpetuation Record Monument and accessories established. Include brief description of area. Set 2½" mag nail in concrete plug over railroad spike. <table border="1"> <thead> <tr> <th>NW Corner</th> <th>Utility Pole</th> <th>Utility Pole</th> <th>Fence Corner</th> </tr> </thead> <tbody> <tr> <td>Barn</td> <td>W/Trans.</td> <td></td> <td>Post</td> </tr> <tr> <td>S 80° E</td> <td>N 30° E</td> <td>N 79° W</td> <td>S 76° E</td> </tr> <tr> <td>38.35'</td> <td>38.08'</td> <td>74.42'</td> <td>18.02' to</td> </tr> <tr> <td></td> <td>Mag Nail + 0.6'</td> <td>Mag Nail + 0.6'</td> <td>bottom nail of</td> </tr> <tr> <td></td> <td>On W. side</td> <td>On S. side</td> <td>survey sign</td> </tr> </tbody> </table>	NW Corner	Utility Pole	Utility Pole	Fence Corner	Barn	W/Trans.		Post	S 80° E	N 30° E	N 79° W	S 76° E	38.35'	38.08'	74.42'	18.02' to		Mag Nail + 0.6'	Mag Nail + 0.6'	bottom nail of		On W. side	On S. side	survey sign
NW Corner	Utility Pole	Utility Pole	Fence Corner																						
Barn	W/Trans.		Post																						
S 80° E	N 30° E	N 79° W	S 76° E																						
38.35'	38.08'	74.42'	18.02' to																						
	Mag Nail + 0.6'	Mag Nail + 0.6'	bottom nail of																						
	On W. side	On S. side	survey sign																						
	Certified corner restoration certificate prepared Yes _____ No <input checked="" type="checkbox"/> Filed in county records at _____ Date _____ County No. _____ Identified on aerial photo No. _____ Which is filed at _____ ISPCS East Zone 1983 Datum (2011) USSF N: 1016488.9 E: 228605.9																								

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____

Harrison Co. No. W-25


25-W

T 5 S R 4E 2nd Mer. County Harrison State Indiana

East Quarter Corner common to section 36

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed N/A Original monument _____ <small>(wood post, stone, pile of stones, etc.)</small>	Year of search N/A By _____ Monument found _____
Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____	Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____
Subsequent Corner Restoration Year surveyed N/A By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc...)</small>	Evidence of Subsequent Corner Restoration Found Year of search 2011 By VHM Recovered mag nail 2½ feet West of East edge of pavement of Old Dam 43 Road. The nail was over a #4 pin, 0.6' deep. See Primavera & Associates Job No. 93-5882.
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____	

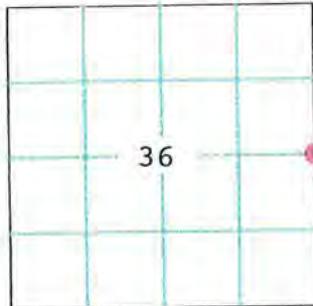

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
Object _____
Record Distance _____
Measured Distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any _____

Perpetuation Record

Monument and accessories established. Include brief description of area. Set mag nail in concrete plug over pin.

Hickory	Tele. Ped.	Cedar	Steel pin w/cap
13"	center	14"	L.S. 336
N 81° W	N 22° E	East	West
30.91'	44.56'	52.25'	27.0'
Mag Nail + 1.3'		Mag Nail + 4.5'	
On S. side W/Sign		On S. side	

Certified corner restoration certificate prepared Yes _____ No X _____

Filed in county records at _____ Date _____ County No. _____

Identified on aerial photo No. _____ Which is filed at _____

ISPCS East Zone 1983 Datum (2011) USSF

N: 1013809.9 E: 228670.5

- At time of search:
- Did you have the record description? Yes No _____
 - How was search area located? pacing, chaining, photo, maps, etc. SURVEYING
 - Man hours spent in search N/A
 - Do you think additional search might recover evidence? Yes _____ No
 - Signature *Vick H. M.*

LAND CORNER RECORD
(RECTANGULAR SURVEYS)

Index No. _____

Harrison Co. No. Y-25


25-Y

T 5 S R 4 E 2nd Mer. County Harrison State Indiana

Southeast Corner common to section 36 (Township Corner)

EXISTING SURVEYS

Original Government Survey		Original Evidence Found
Year surveyed N/A Original monument _____ <small>(wood post, stone, pile of stones, etc.)</small>		Year of search N/A By _____ Monument found _____
Bearing Trees Species _____ Diameter _____ Bearing _____ Distance _____		Original Bearing Trees Found Species _____ Diameter _____ Bearing _____ Distance _____
Subsequent Corner Restoration Year surveyed N/A By _____ Where filed or recorded _____ Monument _____ <small>(Original, concrete post, iron rod, etc..)</small>		Evidence of Subsequent Corner Restoration Found Year of search 2011 By VHM Recovered #4 steel pin w/cap (L.S. 0131), projecting 1.2', with "T" post on West side, 160'± South of bend of Old Dam 43 Road. See Primavera & Associates Job No. 93-5382.
Bearing Trees, Reference Objects Species _____ Diameter _____ Bearing _____ Distance _____		

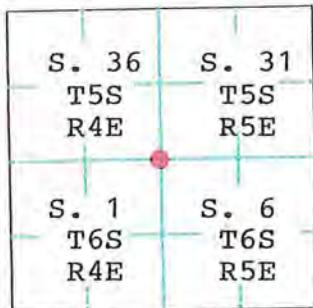

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
Object _____
Record Distance _____
Measured Distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc... Cite source of testimony, If any Monument is in hardwoods on South facing slope 25'± North of creek.

Perpetuation Record

Monument and accessories established. Include brief description of area. The corner position is supported by very old and distinct cultural features in the vicinity.

Sugar 9"	R. Oak 22"	Ash 7"
S 34° E 17.64' slope	N 82° E 26.46'	N 52° W 15.1' slope
Mag Nail + 4.5' On W. side W/Sign	Unmarked	Mag Nail + 0.5' On E. side

- At time of search:
 1. Did you have the record description? Yes No _____
 2. How was search area located? pacing, chaining, photo, maps, etc. SURVEYING
 3. Man hours spent in search N/A
 4. Do you think additional search might recover evidence? Yes _____
 No

5. Signature Vick H. M.

Certified corner restoration certificate prepared Yes No
 Filed in county records at _____ Date _____ County No. _____
 Identified on aerial photo No. _____ Which is filed at _____
 ISPCS East Zone 1983 Datum (2011) USSF
 N: 1011130.9 E: 228734.7